Order	BASE	/ Opt	ion	Codes	

Code 🖃	Component 💌	Base Machine Code 💌
01JAH0202	DESTINATION CODE USA	01JAH
01JAH0409	OPERATION MANUAL - ENGLISH	01JAH
01JAH0505	GEN PURP EXTENDED WEAR PKG	01JAH
01JAH1121	PREMIUM CAB	01JAH
01JAH1221	ENHANCED AIR SUSPENSION SEAT	01JAH
01JAH1379	HID LIGHTS & EXTREMITY	01JAH
01JAH1412	BASIC RADIO PACKAGE	01JAH
01JAH1803	AUTOTRAC READY/HARV MONITOR	01JAH
01JAH1823	GS3 TOUCH SCRN7"COLOR DISPLY	01JAH
01JAH188F	JDLINK ULTIMATE RDA PROMO	01JAH
01JAH2020	PRO DRV TRANS W/HARVESTSMART	01JAH
01JAH2220	2 WHEEL DRIVE	01JAH
01JAH3061	HI TRQ VAR SPD DRV FORE/AFT	01JAH
01JAH4300	SMALL WIRE CONCAVE	013AH
01JAH4814	S-SERIES CLEANING SHOE	01JAH
01JAH4883	TRISTREAM ROTOR XTD WEAR	01JAH
01JAH5349	7.9M UNLOADING AUGER	01JAH
01JAH5601	LESS RUST PROTECTION	013AH
01JAH5756	POWERCAST POWERED TAILBRD	01JAH
01JAH6642	710/65R26 R2 169A8	01JAH
01JAH6746	520/85R42 R1 DUAL 157A8	01JAH
01JAH7015	FINAL TIER 4 ENGINE	01JAH
01JAH8525	CLN GR AUG & FAN BOTM PROTEC	01JAH
01JAH8700	110V COOLANT HTR NO EXPORT	01JAH
01JAH9 <mark>4</mark> 29	XTD WEAR LRG WIRE CC (SET 3)	01JAH
01JAH9433	SEC CONCAVE COVER PLATES	01JAH
01JAH9482	SIDE HILL PERFORMANCE PKG	01JAH
01JAH9486	SEPERATOR GRATE COVERS	01JAH
01JAH9660	NO BRAND PREFERENCE	01JAH

PIP History

PIP Number	PIP Type	PIP Participation Type	PIP Title	PIP Status
16HX508A	Fix-as-Fail	Dealer	16HX508A - S-SERIES VACUUM FAN JACKSHAFT REPLACEMENT	TERMINATED
16HX512A	Mandatory	Dealer	16HX512A - 9.0 LITER LOW TORQUE INJECTOR TUBE - MANDATORY	COMPLETE
16HX512B	Fix-as-Fail	Dealer	16HX512B - 9.0 LITER LOW TORQUE INJECTOR TUBE - FIX AS FAIL	TERMINATED
17HX522A	Mandatory	Dealer	17HX522A - PRODRIVE SERVICE BRAKE SWITCH - MANDATORY	COMPLETE
17HX527A	Mandatory	Dealer	17HX527A - DF3 CHAFFER FRAME IMPROVEMENT - MANDATORY	NOT_COMPLET
17HX527B	Fix-as-Fail	Dealer	17HX527B - DF3 CHAFFER FRAME IMPROVEMENT - FIX AS FAIL	NOT_FAILED
17HX527C	Fix-as-Fail	Dealer	17HX527C - DF3 CHAFFER FRAME IMPROVEMENT - FIX AS FAIL	NOT_FAILED
17HX527D	Fix-as-Fail	Dealer	17HX527D - DF3 CHAFFER FRAME IMPROVEMENT - FIX AS FAIL	NOT_FAILED
18HX568A	Fix-as-Fail	Dealer	18HX568 A - FT4 DEF SYSTEM FILTER UPDATE - FIX AS FAIL	NOT_FAILED

Component Serial Numbers

Component 💌	Serial Number 🕞
CAB	H0CBH00011583
NGINE (DEERE MANUFACTURED)	RG6090U020914
EARBOX, SINGLE SPEED	CEGBLRG246050
RANSMISSION	CET2AAP106512
EARBOX, MULTIPLE SPEED 2	CE2SRAA133895
CR AFTERTREATMENT DEVICE	REXR170005834
NAL DRIVE, LEFT	CEFDHAL105954
AR DRIVE	CEVAAAE206904
ANSMISSION, HYDROSTATIC	28740292
MP, HYD. VARIABLE SPLACEMENT	150719RGP1009
IMP, HYDRO VARIABLE SPLACEMENT, FRONT	43344542
AR BOX	CEGB4D2102248
DULE, TRANSMISSION	CEGBLAF156244
TER OXIDATION DOC	REXD172155956
TALK CHOPPER	201010308550
LTER EXHAUST DPF	REXF172146394
RAME	100000009490
VERSER	CEGBFHL130624
ALK CHOPPER	201020209115
NAL DRIVE, RIGHT	CEFDHAM105919

Model	: \$670	Description	: S670 STS COMBINE PRODRIVE W/HRVSMT	Model : 2015 Year
Latest Delivery Date	: 04 Sep 2015	Last Reported Registration Measurement	: 4	
Machine Build Date	: 04 Aug 2015	Last Reported Claim Measurement	: 967	
Approximate Cumulative Rental Days*	: 0	JDLink Expiration Date	: 05 Sep 2020	
Machine status 1	: Used Machine			
*See John Deere Warranty System for accu	mulated rental days/detailed rental history			

Warranty Coverage

Days Remaining Expiration Date 🖃 Warranty type 🖃 Coverage term 🖃 **Hours Limit Deductible Amount** (may be estimate) Default Warranty 120m/0h 03 Sep 2015 0 N/A 12m/0h 0 N/A Basic Warranty 04 Sep 2016 0 Engine Warranty 24m/2000h 04 Sep 2017 2000 N/A Extended Warranty 36m/2000h 04 Sep 2018 0 2000 USD-250.0 (Comprehensive) 60m/3000h 470 N/A Emissions Warranty 04 Sep 2020 3000

Show / Hide

Claim History

Dealer	Claim # 💌	Туре 💌	Fail Date 💌	Repair Date 💌	Process Date 💌	Ref # 1 💌	Ref # 2 🛒	Measurement 💌
062152	108351918	NORMAL	01 Oct 2015	01 Oct 2015	15 Oct 2015	168662-1	168662	60
062152	109104909	NORMAL	15 Feb 2016	15 Mar 2016	04 Apr 2016	177978-8	177978	261
062152	<u>109104906</u>	NORMAL	15 Feb 2016	15 Mar 2016	25 Mar 2016	177978-7	177978	261
062152	109104882	NORMAL	15 Feb 2016	15 Mar 2016	25 Mar 2016	177978-6	177978	261
062152	109104867	NORMAL	15 Feb 2016	15 Mar 2016	25 Mar 2016	177978-4	177978	261
062152	109104862	NORMAL	15 Feb 2016	15 Mar 2016	25 Mar 2016	177978-3	177978	261
062152	109104840	NORMAL	15 Feb 2016	15 Mar 2016	25 Mar 2016	177978-2	177978	261
062152	<u>109104804</u>	NORMAL	15 Feb 2016	15 Mar 2016	24 Mar 2016	177978-1	177978	261
062152	<u>111171905</u>	NORMAL	15 Mar 2017	07 Apr 2017	09 May 2017	219774-10	219774	675
062152	111171874	NORMAL	15 Mar 2017	07 Apr 2017	09 May 2017	219774-8	219774	675
062152	<u>111171829</u>	NORMAL	15 Mar 2017	07 Apr 2017	09 May 2017	219774-11	219774	675
062152	111171821	NORMAL	15 Mar 2017	07 Apr 2017	09 May 2017	219774-6	219774	675
062152	111171819	NORMAL	15 Mar 2017	07 Apr 2017	09 May 2017	219774-7	219774	675
062152	111171811	NORMAL	15 Mar 2017	07 Apr 2017	09 May 2017	219774-5	219774	675
062152	<u>111171791</u>	NORMAL	15 Mar 2017	07 Apr 2017	09 May 2017	219774-2	219774	675
062152	111171786	NORMAL	15 Mar 2017	07 Apr 2017	09 May 2017	219774-3	219774	675
062152	111171739	NORMAL	15 Mar 2017	07 Apr 2017	09 May 2017	219774-4	219774	675
062152	111171735	NORMAL	15 Mar 2017	07 Apr 2017	09 May 2017	219774-1	219774	675
062152	<u>111171879</u>	NORMAL	15 Mar 2017	07 Apr 2017	05 May 2017	219774-9	219774	675
062152	111171928	NORMAL	23 Mar 2017	07 Apr 2017	09 May 2017	219774-12	219774	675
062152	111081453	PIP	07 Apr 2017	07 Apr 2017	24 Apr 2017	219502-1	219502	675
062152	111651128	PIP	11 Jul 2017	11 Jul 2017	24 Jul 2017	222241-1	222241	762
062152	113129859	NORMAL	26 Mar 2018	09 Apr 2018	21 May 2018	258350-9	258350	967
062152	113129849	NORMAL	26 Mar 2018	09 Apr 2018	21 May 2018	258350-8	258350	967
062152	113129840	NORMAL	26 Mar 2018	09 Apr 2018	21 May 2018	258350-5	258350	967
062152	113129797	NORMAL	26 Mar 2018	09 Apr 2018	21 May 2018	258350-6	258350	967
062152	<u>113129761</u>	NORMAL	26 Mar 2018	09 Apr 2018	21 May 2018	258350-4	258350	967
062152	113129733	NORMAL	26 Mar 2018	09 Apr 2018	21 May 2018	258350-1	258350	967
062152	<u>113129715</u>	NORMAL	26 Mar 2018	09 Apr 2018	21 May 2018	258350-2	258350	967
062152	113129708	NORMAL	26 Mar 2018	09 Apr 2018	21 May 2018	258350-3	258350	967
062152	113129798	NORMAL	29 Mar 2018	09 Apr 2018	21 May 2018	258350-7	258350	967

Failure Part : 51M7047

Failure Mode :	LEAKED	
Failure Area :	VALVE BLOCK	
Failure Mode Comments :		
Downtime :	NO DOWNTIME	
DTAC Case :		
DTAC Solution :		

Parts / Labor / Other Credits

Item	Description	Quantity Approved
51M7047	O RING, JDS-G173 M27 STUD	2
51M7045	O RING, JDS-G173 M22 STUD	4
T77932	O-RING	3
T77857	O-RING	1
T77613	O-RING	3
A	119.75	1.2
		0.0

Complaint

04 LEAK ON POWER CAST TAIL BOARD CONTROL VALVEoil leak on LH side of combine

Cause

plug was lose on valve block

Correction

removed power cast tail board control valve. replaced o ring on plug. reinstalled valve and tested operation.

Failure Mode :
Failure Area :
Failure Mode Comments :
Downtime :
DTAC Case :
DTAC Solution :
Failure Area : ode Comments : Downtime : DTAC Case :

Item	Description	Quantity Approved
19M7866	SCREW, FLANGED, METRIC	16
14M7298	NUT, METRIC, HEX FLANGE	16
AXE48816	CHANNEL, AUGER BED FRONT WIDE	1
AH80335	WEATHERSTRIP ASSY-TAILGATE	8
L	DIAGNOST	0.5
A	119.75	12.4
		853
		0.0

Complaint

01* REPLACE SHOE AUGER BULK HEAD noise from front of combine

Cause

poor weld on shoe auger bulkhead.

Correction

Removed shoe augers and shoe auger pan. cut hole in LH side of combine to let bulk head drop down. removed bulk head and replaced b ulk head and seal. installed shoe auger pan and shoe augers. installed cross shaft and set shoe auger bevel gear backlash.

Failure Part : H218836

Failure Mode :	CAME LOOSE
Failure Area :	SHOE AUGER
Failure Mode Comments :	
Downtime :	NO DOWNTIME
DTAC Case :	
DTAC Solution :	

Parts / Labor / Other Credits		
Item	Description	Quantity Approved
26M4226	KEY, WOODRUFF	1
19M7866	SCREW, FLANGED, METRIC	9
14M7298	NUT, METRIC, HEX FLANGE	9
M48583	KEV, HEAT TREATED	4
JD8665	BEARING	3
JD8554	ECCENTRIC LOCKING COLLAR, COLLAR-LO	2
H171186	SHAFT, SEPARATOR AUGER DRIVE	1
H103264	PRESSED FLANGED HOUSING, FLANGETTE-	5
HXE35167	PRESSED FLANGED HOUSING	1
E10018	PRESSED FLANGED HOUSING, (62MM)	2
AXE13435	LOCKING COLLAR, ASSY, LOW SHAFT SPE	1
AH129452	LOCKING COLLAR	1
AH129451	BEARING, BALL	1
AA5607R	SEAL,OIL	1
L	DIAGNOST	0.75
A	119.75	4.2
		0.0

Complaint

07 REPLACE FRONT SHOE AUGER SHAFTnoise from front of combine

Cause

shoe auger cross shaft key ways were damaged.

Correction

removed shoe auger cross shaft and installed new shaft with new bearings and hardware.

Failure Part : AXE11091

-		
Show	1	Hide

Failure Mode :	LEAKED	
Failure Area :	CHOPPER GEAR CASE	
Failure Mode Comments :		
Downtime :	NO DOWNTIME	
DTAC Case :		
DTAC Solution :		

Parts / Labor / Other Credits		
Item	Description	Quantity Approved
51M7039	O RING, JDS-G173 M10 STUD	1
40M7186	RING, EXTERNAL SNAP	1
T74694	O-RING	1
R11120	PACKING, O RING	1
H64810	PACKING , O-RING	1
E65288	RING, "O"	1
CE32923	COMPRESSION SPRING	1
CE19970	O-RING	1
AXE11092	BALL BEARING,	1
AXE11091	BALL BEARING,	1
AXE11090	BALL BEARING,	2
AN102562	CORNHEAD GEARCASE GRE, 140Z; 397G	1

40M7186	RING, EXTERNAL SNAP	1
T74694	O-RING	1
R11120	PACKING,O RING	1
H64810	PACKING , O-RING	1
E65288	RING, "O"	1
CE32923	COMPRESSION SPRING	1
CE19970	O-RING	1
AXE11092	BALL BEARING,	1
AXE11091	BALL BEARING,	1
AXE11090	BALL BEARING,	2
AN102562	CORNHEAD GEARCASE GRE, 140Z; 397G	1
		144 M
L	DIAGNOST	0.5
A	119.75	3.25
		20010
		0.0

Complaint

06 GREASE LEAKING FROM CHOPPER TWO SPEED GEAR CASE

Cause

bearing was lose and missing seal

Correction

3-29 Removed lower chopper belts removed two speed chopper gear casedissembled gear case and removed all bearing sand seals. Clea ned gear case.3-30Installed new bearings and o rings. filled with grease and installed on combine and tested operation

Failure Part : E65288

Failure Mode :	LEAKED
Failure Area :	FEEDERHOUSE PUMP
Failure Mode Comments :	
Downtime :	NO DOWNTIME
DTAC Case :	
DTAC Solution :	

Parts / Labor / Other Credits		
Item	Description	Quantity Approved
E65288	RING, "O"	1
Ú.	DIAGNOST	0.3
A	119.75	1.5
		0.0

Complaint

05 REPAIR FOR OIL LEAK ON FEEDER HOUSE PUMP MOUNTING 0-RING

Cause

missing o ring on pump

Correction

Removed pump stack and found no o ring on pump, installed new o ring and reinstalled pumps and tested operation.

Failure Part : H218836

-

Failure Mode :	BROKEN
Failure Area :	FINAL DRIVE LH
Failure Mode Comments :	
Downtime :	NO DOWNTIME
DTAC Case :	
DTAC Solution :	

Parts / Labor / Other Credits		
Item	Description	Quantity Approved
H218836	SHAFT, LH DRIVESHAFT, 22T, 728 MM	1
HXE63494	SPLINED COUPLING, COUPLING, DRIVE S	2
L	DIAGNOST	0.3
A	119.75	1.1
		0.0
Complaint		
08 diagnose noise from LH final drive		
Cause		

found coupler and shaft splines were damaged.

Correction

replaced Lh inner shaft and both couplers.

Failure Part : AXE39776

BROKEN	Failure Mode :
HANDRAIL	Failure Area :
	Failure Mode Comments :
NO DOWNTIME	Downtime :
	DTAC Case :
	DTAC Solution :

Parts / Labor / Other Credits		
Item	Description	Quantity Approved
R44302	TIE BAND, BLACK - 7.5 INCH	6
AXE39776	HANDRAIL, RADIATOR DOOR ASSY	1
A	119.75	0.8
		0.0

Complaint

09 engine compartment hand rail is loose

Cause

found hand rail was broken

Correction

replaced handrail.

Failure Part : 17HX522A

	Failure Mode : Failure Area :	NO FAIL MODE GIVEN		
	Failure Mode Comments :			
	Downtime :	N/A		
	DTAC Case :			
	DTAC Solution :			
Parts / Labor / Other Credits				
Item	Descriptio	n	Quantity Approved	
MPH20133	SERVICE B	RAKE PRESSURE SWITCH PRO D	1	
E	129.75		1.0	
-			0.0	
Complaint				
ALL ATUNEDRAL PROPERTY CONTROL PRAYE CHIEF				

01 17HX522A - PRODRIVE SERVICE BRAKE SWITCH - MANDATORY

Cause

17HX522A - PRODRIVE SERVICE BRAKE SWITCH - MANDATORY

Correction

17HX522A - PRODRIVE SERVICE BRAKE SWITCH - MANDATORY762 Engine Hours511 Separator HoursInstalled PIP per instructions. Ran machi ne to check for leaks and proper operation of brakes.

Failure Part : 16HX512A

NO FAIL MODE GIVEN	Failure Mode :
	Failure Area :
	Failure Mode Comments :
N/A	
	DTAC Case :
	DTAC Solution :

Parts / Labor / Other Credits

the first of the second first second second second second second		
Item	Description	Quantity Approved
		0
A	119.75	1.0
		0.0

Complaint

01 16HX512A - 9.0 LITER LOW TORQUE INJECTOR TUBE - MANDATORY

Cause

16HX512A - 9.0 LITER LOW TORQUE INJECTOR TUBE - MANDATORY

Correction

16HX512A - 9.0 LITER LOW TORQUE INJECTOR TUBE - MANDATORYCompleted PIP per instructions. Took longer due to having to clean engine before opening the fuel system.

		2. The second
Failure Mode :	CAME LOOSE	
Failure Area :	SHOE DRIVE	
Failure Mode Comments :		
Downtime :	NO DOWNTIME	
DTAC Case :		
DTAC Solution :		

Item	Description	Quantity Approved	
H134118	PRESSED FLANGED HOUSING, FLANGETTE	8	
AH125975	BALL BEARING, BEARING - BALL	4	
L	DIAGNOST	0.5	
A	119.75	2.1	
		0.0	

Complaint

14 REPLACE SHOE PITMAN ARM BEARINGS ON BOTH SIDES

Cause

Bearings failed allowing free play in shoe drive.

Correction

Removed shoe drive belt and flywheel. Removed pitman bearing assemblies and disassembled. Replaced bearings and flanges. Installed b ear assemblies and torqued all mounting hardware. Installed flywheel and shoe drive belt.

Failure Mode :	ELECTRICAL FAILURE
Failure Area :	DEF SYSTEM
Failure Mode Comments :	
Downtime :	NO DOWNTIME
DTAC Case :	15525660
DTAC Solution :	

Item	Description	Quantity Approved
RE560898	PRESSURE LINE	1
M131313	RETAINER, QUICK CLIP	6
L	DIAGNOST	5.0
A	119.75	2.5
		0.0

Complaint

09 DIAGNOSE AND REPAIR FOR ECU 4341.06 (DEF LINE HEATER)

Cause

DEF pressure line heater failed causing ECU DTC 4341.06.

Correction

Followed diagnostics on Service Advisor for ECU 4341.06 and it lead me to replace the DEF Pressure heater line. After replacing line the machine now had a different DTC (ECU 4341.05) than before. Followed diagnostics and tested all wiring. After submitting and DTA C case they lead me in a new direction and had me perform a harness mode test. After connecting to machine and performing test the c ode still returned. Continued test wiring and connectors. Removed ECU and its connectors to check terminals. Found no issues. Cleane d all connections and installed ECU. Performed harness mode check once more and this time code did not return. Determined that the c ause of the second code was due to a poor connection.

Failure Part : AH219844

Failure Mode :	CAME LOOSE	
Failure Area :	CHAFFER DRIVE	
Failure Mode Comments :		
Downtime :	NO DOWNTIME	
DTAC Case :		
DTAC Solution :		

Parts / Labor / Other Credits

Item	Description	Quantity Approved
19M8486	SCREW, HEX HEAD, METRIC	2
14M7291	NUT, HEX FLANGE M16X2 JD5119 10 ZN	2
AH219846	ARM, SWINGER RH CHAFFER ASSY	1
AH219844	ARM, SWINGER LH CHAFFER ASSY	1
Ĺ	DIAGNOST	0.3
A	119.75	0.75
		0.0

Complaint

01 REPLACE FRONT CHAFFER FRAME LINKS

Cause

Rubber bushing in the link got loose allowing free play in the shoe.

Correction

Replaced both front chaffer frame links and torqued hardware to spec.

Failure Part : AXE61820

Parts / Labor / Other Credits

Failure Mode :	CAME LOOSE	
Failure Area :	SHOE DRIVE	
Failure Mode Comments :		
Downtime :	NO DOWNTIME	
DTAC Case :		
DTAC Solution :		

raits / cabor / other creates		
Item	Description	Quantity Approved
H133621	FLANGETTE	4
AXE61820	BALL BEARING, BALL BEARING	2
AL14674	ECCENTRIC LOCKING COLLAR	2
L	DIAGNOST	0.5
A	119.75	1.0
		0.0

Complaint

03 REPLACE SHOE CROSS SHAFT BEARINGS

Cause

Bearings became loose allowing shaft to move.

Correction

Removed shoe pitman bearings, Replaced cross shaft bearings, flanges and lock collars. Checked for correct shaft placement. Installe d pitman bearings.

CAME LOOSE	Failure Mode :
SIEVE DRIVE	Failure Area :
	Failure Mode Comments :
NO DOWNTIME	Downtime :
	DTAC Case :
	DTAC Solution :

Item	Description	Quantity Approved
14M7291	NUT, HEX FLANGE M16X2 JD5119 10 ZN	2
H227582	BOLT, HEX FLG, M16 X 2 X 135	2
AXE16294	ARM, SWINGER ASSY, SIEVE	2
L	DIAGNOST	0.75
A	119.75	11.25
		0.0

Complaint

02 REPLACE FRONT SIEVE FRAME LINKS

Cause

rubber bushing wore, becoming loose in socket

Correction

Removed chaffer and sieve elements. Removed fixed front chaffer. Removed all chaffer frame hardware. Removed chaffer frame. Replaced front sieve frame links and torqued hardware to spec. Installed components in reverse order and torqued all mounting hardware to spec. Calibrated chaffer and sieve frame openings.

Failure Part : AH231494

Parts / Labor / Other Credits

Failure Mod	e : CAME LOOSE
Failure Are	a : STEERING LINKAGE
Failure Mode Comment	5:
Downtim	e : NO DOWNTIME
DTAC Cas	e :
DTAC Solution	n :

Parts / Labor / Other Credits		
Item	Description	Quantity Approved
14H1086	NUT, HEX SLOTTED	1 100 100 100 100 100 100 100
11M7087	PIN, COTTER	1
AH231494	TIE ROD END, ASSY	1
L	DIAGNOST	0.2
A	119.75	0.8
		0.0

Complaint

05 REPLACE LH OUTER TIE ROD END

Cause

Ball became loose in socket of tie rod end.

Correction

Lifted LH side of rear axle. Removed tie rod. Installed new tie rod and checked for correct toe in. Lowered combine.

Failure Information Failure Part : HXE84785 Failure Mode : BLOWN Failure Area : FEEDERHOUSE Failure Mode Comments : Downtime : NO DOWNTIME DTAC Case : DTAC Solution : Parts / Labor / Other Credits **Quantity Approved** Item Description HXE84785 ISOLATOR, UPPER, FORE/AFT FRAME, HF 1 A 119.75 0.75 0.0 Complaint 07 REPLACE FEEDER HOUSE FORE AND AFT FRAME SEAL

Cause

Seal ripped allowing dust and grain out of feeder house.

Correction

Removed old seal and cleaned residue from mating surfaces. Installed new seal.

Failure Part : HXE16935

Parts / Labor / Other Credits

IMPROPER FIT	Failure Mode :
MOISTURE SENSOR	Failure Area :
	Failure Mode Comments :
NO DOWNTIME	Downtime :
	DTAC Case :
	DTAC Solution :

Parts / Labor / Other Credits		
Item	Description	Quantity Approved
H154379	SEALANT	1
HXE16935	GASKET, AGL EMU SEAL	1
L	DIAGNOST	0.25
A	119.75	1.05
		0.0

Complaint

06 REPLACE MOISTURE SENSOR GASKET

Cause

Gasket pulled away from elevator allowing grain to pack between elevator and gasket.

Correction

Removed moisture sensor and cleaned surfaces. Installed new gasket with sealant. Installed moisture sensor.

Failure Part : AL206976

Failure Mode : Failure Area : Failure Mode Comments : Downtime : DTAC Case : DTAC Solution :	ELECTRICAL FAILURE STEERING SYSTEM NO DOWNTIME	
Failure Mode Comments : Downtime : DTAC Case :		
Downtime : DTAC Case :	NO DOWNTIME	
DTAC Case :	NO DOWNTIME	
DTAC Solution :		
Descriptio	n	Quantity Approved
SENSOR, ST	TEERING INPUT DEVICE	1
DIAGNOST		0.75
		1.25
115.75		1.25
		0.0
	SENSOR, S	Description SENSOR, STEERING INPUT DEVICE DIAGNOST 119.75

Complaint

13 DIAGNOSE AND REPAIR FOR MULTIPLE SSU CODES (REPLACE STEERING WHEEL POSITION SENSOR)

Cause

Steering wheel position sensor failed.

Correction

Followed diagnostics in Service Advisor and it lead me to replace the steering wheel position sensor. Removed EH steering valve and replaced sensor. Performed SSU calibration and code did not return.

Failure Mode :	BROKEN
Failure Area :	FORE AFT
Failure Mode Comments :	
Downtime :	NO DOWNTIME
DTAC Case :	
DTAC Solution :	

Item	Description	Quantity Approved	
19M7865	SCREW, FLANGED, METRIC	2	
19M7844	SCREW, FLANGED, METRIC	8	
19M7784	SCREW, FLANGED, METRIC	2	
L	DIAGNOST	0.25	
A	119.75	3.25	
		0.0	

Complaint

08 REPLACE BROKEN BOLT ON FEEDER HOUSE FORE AND AFT FRAME PIN

Cause

The bolt that holds in the fore and aft tilt pin had broke allowing pin to come out of place.

Correction

Removed LH tilt cylinder to gain access to bolt. Could not get a good angle to drill bolt out with tilt frame in place. Removed tilt frame. Drilled out broken bolt and tapped threads. Found that the pivot pin had worked out of position and had to be drove back in. Installed new bolt with thread locker. Also replaced bolt on RH side of feeder house because it was working loose. Installed face f rame and torqued mounting bolts. Installed tilt cylinders.

Failure Information

Failure Part : AXE14245

Failure Mode :	ELECTRICAL FAILURE	
Failure Area :	FORE AFT	
Failure Mode Comments :		
Downtime :	NO DOWNTIME	
DTAC Case :		
DTAC Solution :		

Parts / Labor / Other Credits		
Item	Description	Quantity Approved
P48347	O-RING	1
AXE14888	SHAFT, ROUGH SERVICE DEVICE	1
AXE14245	SENSOR, ROTATION, HALL 2CH +/-60DEG	1
A	119.75	0.5
		0.0

Complaint

12 DIAGNOSE AND REPAIR FOR LC1 516336.20 & 516724.07 (FEEDER HOUSE FORE AND AFT SENSOR)

Cause

Sensor failed.

Correction

Followed diagnostics in Service Advisor and it lead me to replace the position sensor. Replaced sensor and performed calibration. Co de did not return.

Failure Part : 19M8288

Parts / Labor / Other Credits

Failure Mode :	BROKEN
Failure Area :	LH AXLE EXTENSION
Failure Mode Comments :	
Downtime :	NO DOWNTIME
DTAC Case :	
DTAC Solution :	

Parts / Labor / Other Credits		
Item	Description	Quantity Approved
24M7243	WASHER, METALLIC, ROUND HOLE	6
19M8288	SCREW, HEX HEAD, METRIC	6
14M7533	NUT, METRIC, THIN HEX	2
14M7431	NUT, METRIC, HEX	2
14M7278	NUT, METRIC, HEX	6
H133635	ROD-TRUSS	1
H130288	NUT - SPHERICAL	2
H130287	SPACER, BUSHING, WASHER	2
L	DIAGNOST	0.25
A	100.00	1.75
		0.0

Complaint

noise while drive machine in field

Cause

found two bolts holding axle spacer to combine frame were missing and other bottom bolts were lose.

Correction

Replaced all hardware on axle extension and replace truss rod between the two extensions. Also checked torque on hardware on other s ide of machine at this time.

	Failure	Part	: TY	22467
--	---------	------	------	-------

Failure Part : TY22467				Show / Hide
	Failure Mode :	LEAKED		
	Failure Area :	ENGINE		
	Failure Mode Comments :			
	Downtime :	NO DOWNTIME		
	DTAC Case :			
	DTAC Solution :			
Parts / Labor / Other Credits				
Item	Descriptio	n	Quantity Approved	
TV22467	WORM GEA	R CLAMP(TYPE"F")	.6	
HXE42756	HYDRAULIC	HOSE - FABRICATE, MAIN HY	1	
AXE12744	HOSE CLAN	1P, CLAMP, WAVELINER 35.4 D	2	
в	100.00		0,5	
A	100.00		1,55	
			0.0	
Complaint				
Oil leak in engine compartment				

Cause

Found hose clamp had failed

Correction

Cleaned all the leaked oil from the machine. Drained oil from hydraulic reservoir, replaced hose from main hydraulic pump to reservoir and hose clamps. Checked other hose clamps and found they were loose, so they were replaced as well. Add oil back to reservoirand checked for leaks

Failure Part : H171960

	Failure Mode :	OMITTED / MISSING		
	Failure Area :	FEEDERHOUSE		
	Failure Mode Comments :			
	Downtime :	NO DOWNTIME		
	DTAC Case :			
	DTAC Solution :			
Parts / Labor / Other Credits				
Item	Descriptio	n	Quantity Approved	
H171960	STRIP, UPP	ER RETURN WEAR	4	
A	100.00		2.4	
			0.0	
Complaint				
FEEDERHOUSE RETURN FLOOR WEAR STRIPS				
Record on a				
Cause				
Wear strips missing				
Correction				
Replaced the missing wear strips				

Failure Part : AH131860

Failure Mode :	LEAKED	
Failure Area :	CLEAN GRAIN GEARCASE	
Failure Mode Comments :		
Downtime :	NO DOWNTIME	
DTAC Case :		
DTAC Solution :		

Parts / Labor / Other Credits

Item	Description	Quantity Approved
TV26373	GL-5,80W140 SYNTHETIC GEAR LUBE 5GL	4 A MALE AND A
R69706	NUT, SELF LOCKING	2
JD7689	BEARING, BALL	1
DE20207	BALL BEARING 62065H2 C3	1
CE21767	SHAFT KEY, SHAFT KEY, KEY, SHAFT	2
AH21815	SEAL ASSY-OIL	1
AH131860	SEAL - OIL DUAL DIRT LIP	1
AE42998	TAPERED ROLLER BEARING	1
L	DIAGNOST	0.25
В	100.00	0.5
A	100.00	5.0
		0.0

Complaint

Oil leak on clean grain elevator gear case

Cause

found seal was leaking on gear case

Correction

Used four quarts of TY26373 as oil was contaminated from failure. Cleaned off the machine for repairs. Removed gear case and drainedoil out of gear case. Oil had metal into so all bearings and seals were replaced. refilled gear case with oil and reinstalled incombine

Failure Part : AXE14245

CALIBRATION	Failure Mode :	
FEEDERHOUSE	Failure Area :	
	Failure Mode Comments :	
NO DOWNTIME	Downtime :	
	DTAC Case :	
	DTAC Solution :	

Parts / Labor / Other Credits

Description	Quantity Approved
	0
DIAGNOST	0.6
100.00	1.2
	0.0
	DIAGNOST

Complaint

Feeder house fore and aft doesn't move.

Cause

Found sensor needed recailbrated

Correction

Preformed feeder house fore and aft calibration, no codes returned and is functioning normally.

Failure Mode : CAME LOOSE	Failure Mode :	
Failure Area : WHEEL ANGLE SENSO	Failure Area :	
ailure Mode Comments :	Failure Mode Comments :	
Downtime : NO DOWNTIME	Downtime :	
DTAC Case :	DTAC Case :	
DTAC Solution :	DTAC Solution :	

Item	Description	Quantity Approved
34H258	PIN, SPRING	1
DE20796	SPINDLE, SHAFT ASSY	0
AXE11477	SENSOR, ASSY, HALL POSITON KINGPIN	1
L	DIAGNOST	1.5
A	100.00	2.0
		0.0

Complaint

Wheel angle sensor codes while harvesting

Cause

Found wheel angle sensor shaft was lose in housing

Correction

Replaced wheel angle sensor in housing and attempted to recalibrate. Diagnose new codes and found wheel angle sensor was faulty. Replaced wheel angle sensor and recalibrated system.

Failure Mode :	SOFTWARE / REPROG
Failure Area :	GRAIN LOSS CONTROLLER
Failure Mode Comments :	
Downtime :	LESS THAN 4 HOURS
DTAC Case :	
DTAC Solution :	

Item	Description	Quantity Approved	
1.22.1		0	
LX	DIAGNOST	0.82	
E	110.00	1.5	
1828			
		0.0	

Complaint

GRAIN LOSS MONITOR WILL NOT CALIBRATE

Cause

faulty software

Correction

Cannot calibrate grain loss monitor and display. Checked codes on machine and had GLM codes for sensors not functional and system n ot calibrated, ran combine and attempted to calibrate grain loss but the grain loss would not calibrate. Downloaded software from SDS and updated all controller software and ran combine in field and calibrated grain loss display, grain loss worked fine after ne w software was installed.

Failure Part : AXE27393

Parts / Labor / Other Credits

Failure Mode :	LEAKED
Failure Area :	STEERING PUMP SUPPLY
Failure Mode Comments :	
Downtime :	NO DOWNTIME
DTAC Case :	
DTAC Solution :	

Item	Description	Quantity Approved
T78612	O-RING	3
T76938	0-RING	1
TY26101	BRAKE AND PARTS CLEANER-US ONLY	0
AXE27393	HYDRAULIC HOSE - FABRICATE, SUCTION	1
AXE24936	HVDRAULIC HOSE - FABRICATE, SUCTION	1
L	DIAGNOST	0.5
A	119.75	2.2
		0.0

Complaint

03 STEERING PUMP SUPPLY HOSE LEAKINGoil leak on LH side of combine

Cause

hoses were leaking at crimp on hose.

Correction

drained oil out of main engine gear case. replaced hose on steering pump supply and prodrive pump supply hoses. filled gear case with oil and tested operation

Failure	Part :	AXE21	789
---------	--------	-------	-----

	Failure Mode :	LEAKED	
	Failure Area :	SINGLE POINT COUPLER	
	Failure Mode Comments :		
	Downtime :	NO DOWNTIME	
	DTAC Case :		
	DTAC Solution :		
Parts / Labor / Other Credits			
Item	Descriptio	Quantity Approved	
AXE21789	VALVE, MUL	1	
A	119.75		0.4

0.0

Complaint

02* REPLACE COUPLER ON MULTI-COUPLER - PRICING PER COUPLERoil leak on single point

Cause

coupler seal had failed

Correction

replaced one fore and aft coupler on combine side of single point.



Landmark Implement Inc.

111 Chestnut Arapahoe, NE 68922 Phone: 308-962-7448 Fax: 308-962-5424 www.landmarkimp.com Arapahoe@landmarkimp.com



Invoice To Account No:	Deliver To:			SE	ERVICE INVOICE
Internal Used Stock No. 170094	Internal Use	d Sto	ock No. 170094	Invoice Number:	10566966
				Invoice Date:	10/12/2018
				Location:	07
				Work Order Number:	277598
				Payment Type:	Account
Bus Phone:	Bus Phone:				
Prv Phone:	Prv Phone:			Page:	1 of 4
Make/Model:	M	eter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE JD S670 COMBINE	11	16	1H0S670STF0776360	PF776360	

/HCWASH2 Internal

COMPLAINT:

01 LEVEL 2 COMBINE WASH, WASH EXTERIOR AND UNDER SHIELDS

CORRECTION:

	Labor: \$400.00	Parts: \$0.00	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$400.00
--	-----------------	---------------	--------------	--------------	---------------------

/S670G1138826 Internal

COMPLAINT:

02 CONCAVE, R&R - INCLUDES LEVELING

CORRECTION:

LOWERED, LOOSENED AND REMOVED SMALL WIRE CONCAVES FROM COMBINE. INSTALLED AND CHECKED LEVEL OF ROUND BAR CONCAVES. CLEARANCES WERE SERVICEABLE. SET COMBINE FOR DRY CORN, BOTH OUTSIDE SETTINGS AND THROUGH DISPLAY. CHECKED COMBINE OPERATION, GOOD.

INSPECTED COMBINE. ADJUSTED FEEDER HOUSE CONVEYOR CHAIN AND DRIVE CHAIN TENSION.	
ADJUSTED CLEAN GRAIN ELEVATOR, DISCHARGE BEATER, AND ROTARY JACKSHAFT BELTS.	
ADJUSTED TENSION ON CLEAN GRAIN AND TAILINGS ELEVATORS.	
CHECKED OPERATION AGAIN, GOOD.	

Labor: \$598.75	Parts: \$0.00	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$598.75

/S670G000012 Internal

COMPLAINT: 03 LANDMARK COURTESY PRE-WORK CHECKLIST MAKE SURE WE FILL OUT CHECK LIST. CHECK CHAFFER FRAME

CORRECTION:



Landmark Implement Inc.

111 Chestnut Arapahoe, NE 68922 Phone: 308-962-7448 Fax: 308-962-5424 www.landmarkimp.com Arapahoe@landmarkimp.com



Invoice To Account No: Deliver To:			SERVICE INVOICE		
Internal Used Stock No. 170094	Internal Used S	Stock No. 170094	Invoice Number:	10566966	
			Invoice Date:	10/12/2018	
			Location:	07	
			Work Order Number:	277598	
			Payment Type:	Account	
Bus Phone:	Bus Phone:				
Prv Phone:	Prv Phone:		Page:	2 of 4	
Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:	
JOHN DEERE JD S670 COMBINE	1116	1H0S670STF0776360	PF776360		

/S670G000012 Internal

REPAIR Y/N--- SAFETY EQUIPMENT PTO Shields Steps and Handrails Warning Lights SMV Emblem LEAKS Engine oil Coolant Fuel Hydraulic oil OPERATOR STATION A/C & Heater Operation Light system, Field and Road Radio Operation Operation of All Controls in the Cab Seat Operation and Adjustments FLUID LEVELS Engine Oil Engine Coolant ANDMARK Hydraulic Oil DTC's, SERVICE INTERVALS (CODES) Recall & Record DTC's **Check Service Intervals** PHYSICAL DAMAGE Damaged Glass/Mirrors Cracks in Plastic/Fiberglass Parts. Paint/Finish Damage Cab Interior Damage OL&M: \$0.00 Labor: \$20.36 Parts: \$0.00 Misc: \$0.00 Sub-Total: \$20.36

/S670SERVICE Internal

COMPLAINT: 04 SERVICE COMBINE FILTERS AND FLUIDS

CORRECTION:



111 Chestnut Arapahoe, NE 68922 Phone: 308-962-7448 Fax: 308-962-5424 www.landmarkimp.com Arapahoe@landmarkimp.com



Invoice To Account No:	Deliver To:		SEF	RVICE INVOICE
Internal Used Stock No. 170094	Internal Used Sto	ock No. 170094	Invoice Number:	10566966
			Invoice Date:	10/12/2018
			Location:	07
			Work Order Number:	277598
			Payment Type:	Account
Bus Phone:	Bus Phone:			
Prv Phone:	Prv Phone:		Page:	3 of 4
Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE JD S670 COMBINE	1116	1H0S670STF0776360	PF776360	

/S670SERVICE Internal

REPLACED ALL FILTERS. DRAINED; ENGINE OIL. REVERSER GEARCASE. PRIMARY COUNTERSHAFT GEARCASE. REFILLED TO SPECIFICATIONS. CHECKED THE COMBINE FOR; JOHN DEERE RECOMMENDED TIRE PRESSURES. ALL FLUID LEVELS ARE AT SPECIFIED LEVELS. REMOVED AND CLEANED CAB AIR PRE-CLEANER. GREASED ALL LUBE POINTS ON THE COMBINE. REPAIRS/ADJUSTMENTS NOT COVERED ON THIS SEGMENT.

T734 T750

<u>Part Number</u> AXE42066	<u>Description</u> Filter Element	<u>Quantity</u> 1.00	<u>List Price</u> 89.85	<u>Net Price</u> 89.85	Extended Price \$89.85	<u>Taxed Ind</u> N
HXE11090	Filter Element	1.00	165.93	165.93	\$165.93	Ν
L214634	Recirculating Filter	1.00	18.58	18.58	\$18.58	Ν
RE284091	Cab Air Filter	EN/ E1.00	59.18	59.18	\$59.18	Ν
RE509672	Oil Filter Element	1.00	19.24	19.24	\$19.24	Ν
RE533910	Fuel Filter	1.00	117.17	117.17	\$117.17	Ν
RE539465	Filter Element	1.00	95.41	95.41	\$95.41	Ν



111 Chestnut Arapahoe, NE 68922 Phone: 308-962-7448 Fax: 308-962-5424 www.landmarkimp.com Arapahoe@landmarkimp.com



Invoice To Account No:	Deliver To:			SERVIC	E INVOICE
Internal Used Stock No. 170094	Internal Used Stock	No. 170094	Inv Work Orde	Number: oice Date: Location: r Number: nent Type:	10566966 10/12/2018 07 277598 Account
Bus Phone:	Bus Phone:		l i ayı		
Prv Phone:	Prv Phone:			Page:	4 of 4
Make/Model:	Meter:	Serial Number:	Eq ID:	F	leet No:
JOHN DEERE JD S670 COMBINE	1116	1H0S670STF0776360) PF7763	60	
/S670SERVICE Internal TY26682 Plus-50 II Oil Labor: \$598.75 Parts: \$865	15W40 CJ4/SN		0.00 15	00 15.00 Sub-Total:	\$300.00 N
Customer PO No: Tax Exempt No: Advisor: SCOTT HAMILTON				Labor: Parts: OL&M: Misc: Sales Tax:	\$865.36 \$0.00 \$0.00
*** DOCUMENT COPY ***				Grand Total:	

LANDMARK EXCLUSIVE WARRANTY OFFER! We're now offering a 1 year warranty on labor for all non-maintenance items only when work is completed by one of our factory trained John Deere technicians. For parts only purchase over the counter we have a 6 month warranty on John Deere parts.

TERMS AND CONDITIONS

Approved charges are due by the 10th of the month following purchase, I agree to pay a monthly periodic FINANCE CHARGE at the rate of 1.33% which is an ANNUAL PERCENTAGE CHARGE OF 16% on the unpaid balance. The purchaser agrees to pay reasonable attorney fees if collection efforts are required.



910 West Highway 36 Smith Center, KS 66967 Phone: 785-282-6601 Fax: 785-282-6958 www.landmarkimp.com Smithcenter@landmarkimp.com



Invoice To Account No:	Deliver To:		SE	RVICE INVOICE
Internal New Stock No. 67447 (Sold)	Internal New	Stock No. 67447 (Sold)	Invoice Number:	816518
			Invoice Date:	9/23/2015
			Location:	03
			Work Order Number:	164600
			Payment Type:	Account
Bus Phone:	Bus Phone:			
Prv Phone:	Prv Phone:		Page:	1 of 3
Make/Model:	Mete	r: Serial Number:	Eq ID:	Fleet No:
JOHN DEERE S670 STS COMBINE	4	1H0S670STF0776360	PF776360	

/PDIS670 Internal

COMPLAINT:

01 SET-UP/PREDELIVER COMBINE.

CORRECTION:

Performed all PDI instructions. Calibrated the shoe, transmission, wheel angle sensors, grain bin covers and feeder house. Ran machine for a couple hours to ensure proper operation and to check for leaks. Checked operation of all functions and lights. Checked tire pressures. Set machine for fall crops.

Q	,599.99	Parts:	\$0.00	OL&M:	\$0.00	Misc:	\$0.01	Sub-Total:	\$2,600.00
S670DUSPACE	E Internal								
COMPLAINT:			1 5-						
02 INSTALL SP	ACERS AND DU	JALS ON	COMBINE						
CORRECTION:			1					- R	
installed spacers	s and truss rod p	per instru	ctions and torqu	ued all hardwa	re.				
				/AVAV		VIVA	V = 1.54		
Labor: \$93	30.00	Parts:	\$0.00	OL&M:	\$0.00	Misc:	\$0.00	Sub-Total:	\$930.00
				< 10	() PIL)=	WJEN	T /		
	Internal		N	< a	ale) He		Ū /		
/S670A&ICAM COMPLAINT:			h		MPUS		U/		
/S670A&ICAM COMPLAINT:	Internal				лры		u /		
/S670A&ICAM COMPLAINT: 03 INSTALL S					APUE		Ū		
/S670A&ICAM COMPLAINT: D3 INSTALL S CORRECTION:	IDE HILL KIT				ЛРИВ		Ţ		
/S670A&ICAM COMPLAINT: D3 INSTALL S CORRECTION:		linstruct	ions.						

/S670DIAG Internal

COMPLAINT: 04 UNLOAD COMBINE



910 West Highway 36 Smith Center, KS 66967 Phone: 785-282-6601 Fax: 785-282-6958 www.landmarkimp.com Smithcenter@landmarkimp.com



Invoice To Account No:	Deliver To:		S	ERVICE INVOICE
Internal New Stock No. 67447 (Sold)	Internal New	Stock No. 67447 (Sold)	Invoice Number:	816518
			Invoice Date:	9/23/2015
			Location:	03
			Work Order Number:	164600
			Payment Type:	Account
Bus Phone:	Bus Phone:			
Prv Phone:	Prv Phone:		Page:	2 of 3
Make/Model:	Mete	er: Serial Number:	Eq ID:	Fleet No:
JOHN DEERE S670 STS COMBINE	4	1H0S670STF0776360	PF776360	

/S670DIAG Internal

went to unload combine from trailer and found that the rear wheels that were shipped were wrong, so had to go and take rear tires off another combine to be able to unload. let office know and they ordered the right tires and jesse and i put them on when they came in. reinstalled tires on used combine and retorqued them.

Labor: \$1,150.01	Parts:	\$0.00	OL&M:	\$0.00	Misc:	(\$0.01)	Sub-Tota	: \$1,150.00	
5670G1138976 Internal OMPLAINT: 6 SWAP RADIO									
ORRECTION: ttempted to swap radios with a	another c	ombine only to	find out that it v	vas not possib	le.				
stalled aftermarket xm receive	er.								
<u>Part Number</u>	<u>Descript</u> i				Quantity	List Price	Net Price E	xtended Price	Taxed Ind
			< 10	APLE	MEN	Ī			



910 West Highway 36 Smith Center, KS 66967 Phone: 785-282-6601 Fax: 785-282-6958 www.landmarkimp.com Smithcenter@landmarkimp.com



nvoice To Account No:	Deli	ver To:				SERVIC	E INVO	DICE
nternal New Stock No. 67447 (S	old) Inte	ernal New Stock	k No. 67447 (Sold)		Invoice Num	ber:	8	16518
					Invoice D	ate:	9/	23/2015
					Locat	ion:		03
				W	ork Order Num	ber:		164600
					Payment Ty	ype:		Account
Bus Phone:	=	s Phone:			_			
Prv Phone:	Prv	Phone:			Pa	ige:		3 of 3
Make/Model:		Meter:	Serial Number:		Eq ID:	FI	eet No:	
JOHN DEERE S670 STS COMBIN	E	4	1H0S670STF0776	360	PF776360			
Labor: \$300.01 Pr	arte: \$1 /0	OL & M	· \$0.00	Misc	(\$0.01)	Sub-Total:	\$301 49	
· · ·	arts: \$1.49	OL&M:	: \$0.00	Misc:	(\$0.01)	Sub-Total:	\$301.49	\$200.0
Miscellaneous Charges: Service Accessories	arts: \$1.49	OL&M	: \$0.00	Misc:	(\$0.01)	Labor:		\$200.00
Miscellaneous Charges: Service Accessories Customer PO No:	arts: \$1.49	OL&M	: \$0.00	Misc:	(\$0.01)	Labor: Parts:		,330.00 \$1.49
Miscellaneous Charges: Service Accessories Customer PO No: Tax Exempt No:		OL&M	: \$0.00	Misc:	(\$0.01)	Labor: Parts: OL&M:	\$5	,330.00 \$1.49 \$0.00
Miscellaneous Charges: Service Accessories Customer PO No:		OL&M	: \$0.00	Misc:	(\$0.01)	Labor: Parts: OL&M: Misc:	\$5	,330.00 \$1.49 \$0.00 \$200.00
Miscellaneous Charges: Service Accessories Customer PO No: Tax Exempt No:		OL&M	: \$0.00	Misc:	(\$0.01)	Labor: Parts: OL&M:	\$5	

LANDMARK EXCLUSIVE WARRANTY OFFER! We're now offering a 1 year warranty on labor for all non-maintenance items only when work is completed by one of our factory trained John Deere technicians. For parts only purchase over the counter we have a 6 month warranty on John Deere parts.

TERMS AND CONDITIONS

Approved charges are due by the 10th of the month following purchase, I agree to pay a monthly periodic FINANCE CHARGE at the rate of 1.33% which is an ANNUAL PERCENTAGE CHARGE OF 16% on the unpaid balance. The purchaser agrees to pay reasonable attorney fees if collection efforts are required.



910 West Highway 36 Smith Center, KS 66967 Phone: 785-282-6601 Fax: 785-282-6958 www.landmarkimp.com Smithcenter@landmarkimp.com



Invoice To Account No:	Deliver To:		SE	RVICE INVOICE
WARRANTY			Invoice Number:	10032243
			Invoice Date:	3/23/2016
			Location:	03
			Work Order Number:	177978
			Payment Type:	Account
Bus Phone:				
Prv Phone:			Page:	1 of 5
Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE S670	261	1H0S670STF0776360	PF776360	

/S670G1138919 Warranty

COMPLAINT:

Noise in final drive while driving down the road

CORRECTION:

removed duals from machine and final drive. Dissembled final drive and found cracked ring gear in final drive. Input gear was also damaged. While final drive was apart also replaced all bearings and seals in final drive. Replaced ring gear and input gear. Reinstalled final drive on combine and filled final drive with new oil and reinstalled wheels

<u>Part Number</u> AH112401	<u>Description</u> SEAL	<u>Quantity</u> 1.00	<u>List Price</u> 81.50	<u>Net Price</u> 81.50	Extended Price \$81.50	<u>Taxed Ind</u> N
AH155232	V-RING SEAL	1.00	34.86	34.86	\$34.86	Ν
AN12151	SEAL	1.00	19.13	19.13	\$19.13	Ν
H154720	CAP	1.00	11.98	11.98	\$11.98	Ν
H161541	SHIM	2.00	6.42	6.42	\$12.84	Ν
H161542	SHIM	2.00	4.49	4.49	\$8.98	Ν
H161543	SHIM	2.00	3.13	3.13	\$6.26	Ν
H161871	V-RING SEAL	1.00	22.24	22.24	\$22.24	Ν
H163745	SHIM	2.00	5.58	2.79	\$5.58	Ν
H167723	Gear	1.00	3,531.16	3,531.16	\$3,531.16	Ν
JD10134	BEARING CO	1.00	164.60	164.60	\$164.60	Ν
JD10135	BEARING CUP	1.00	105.23	105.23	\$105.23	Ν
JD10266	BEARING CO	1.00	53.87	53.87	\$53.87	Ν
JD7298	BEARING CU	1.00	34.58	34.58	\$34.58	Ν
JD9058	BEARING CO	2.00	37.77	37.77	\$75.54	Ν
JD9121	BEARING CU	2.00	19.39	19.39	\$38.78	Ν
N377016	Pinion	1.00	655.44	655.44	\$655.44	Ν
N380924	Nut	1.00	65.44	65.44	\$65.44	Ν
R90080	OIL CUP	1.00	27.19	27.19	\$27.19	Ν
TY24416	GREASE	1.00	3.21	3.21	\$3.21	Ν
TY26101	BRAKE/CLUTCH	2.00	4.92	4.92	\$9.84	Ν



910 West Highway 36 Smith Center, KS 66967 Phone: 785-282-6601 Fax: 785-282-6958 www.landmarkimp.com Smithcenter@landmarkimp.com



SERVICE INVOICE Invoice To Account No: Deliver To: WARRANTY **Invoice Number:** 10032243 3/23/2016 Invoice Date: Location: 03 Work Order Number: 177978 Account Payment Type: Bus Phone: 2 of 5 Prv Phone: Page: Make/Model: Serial Number: Fleet No: Meter: Eq ID: JOHN DEERE S670 261 1H0S670STF0776360 PF776360 /S670G1138919 Warranty LUBRICANT 1.00 7.72 6.46 \$6.46 TY6296 Ν

Labor: \$1,015.00 Parts: \$4,974.71 OL&M: \$0.00 Misc: \$0.00 Sub-Total: \$5,989.71

/S670G1138948 Warranty

COMPLAINT:

noise while drive machine in field

CORRECTION:

Replaced all hardware on axle extension and replace truss rod between the two extensions. Also checked torque on hardware on other side of machine at this time.

Labor: \$200.00	Parts: \$528.69	OL&M: \$0.00	Misc: \$	0.00	Sub-To	otal: \$728.69	
H133635	Rod		1.00	333.81	333.81	\$333.81	Ν
H130288	NUT		2.00	6.06	6.06	\$12.12	N
H130287	SPACER	< IIIIIIIIIII	2.00	33.36	33.36	\$66.72	N
24M7243	WASHER		6.00	5.64	2.82	\$16.92	N
19M8288	CAP SCREW	≜♥ム♥/@ / ∖	6.00	7.58	7.58	\$45.48	N
14M7533	NUT	an a	2.00	9.98	9.98	\$19.96	N
14M7431	NUT		2.00	7.27	7.27	\$14.54	N
<u>Part Number</u> 14M7278	Description NUT		<u>Quantity</u> 6.00	List Price 3.19	<u>Net Price</u> 3.19	Extended Price \$19.14	<u>Taxed Ind</u> N

/S670G1138882 Warranty

COMPLAINT:

Oil leak in engine compartment

CORRECTION:

Cleaned all the leaked oil from the machine. Drained oil from hydraulic reservoir. replaced hose from main hydraulic pump to reservoir and hose clamps. Checked other hose clamps and found they were loose, so they were replaced as well. Add oil back to reservoir and checked for leaks

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
AXE12744	Hose Clamp	2.00	7.39	7.39	\$14.78	N



910 West Highway 36 Smith Center, KS 66967 Phone: 785-282-6601 Fax: 785-282-6958 www.landmarkimp.com Smithcenter@landmarkimp.com



100322 3/23/20 1775 Acco 3 0 Io: 2.16
1779 Acco 3 (
Acco 3 lo:
Acco 3 lo:
3 lo:
lo:
2.16
2.16
2.16
1.52
3.46
Price <u>Taxeo</u>
3.08
3.08
Price Taxed
0.66
0.66
0.66 5.30
03

OL&M: \$0.00

Misc: \$0.00

/S670G1138788 Warranty

Labor: \$200.00

Parts: \$471.49

COMPLAINT:

Sub-Total: \$671.49



910 West Highway 36 Smith Center, KS 66967 Phone: 785-282-6601 Fax: 785-282-6958 www.landmarkimp.com Smithcenter@landmarkimp.com



Invoice To Account No:	Deliver To:		SE	ERVICE INVOICE
WARRANTY			Invoice Number:	10032243
			Invoice Date:	3/23/2016
			Location:	03
			Work Order Number:	177978
			Payment Type:	Account
Bus Phone:				
Prv Phone:			Page:	4 of 5
Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE S670	261	1H0S670STF0776360	PF776360	

/S670G1138788 Warranty

Oil leak on clean grain elevator gear case

CORRECTION:

Used four quarts of TY26373 as oil was contaminated from failure. Cleaned off the machine for repairs. Removed gear case and drained oil out of gear case. Oil had metal into so all bearings and seals were replaced. refilled gear case with oil and reinstalled in combine

<u>Part Number</u> AE42998	Description TAPERED RO	<u>Quantity</u> 1.00	<u>List Price</u> 52.42	<u>Net Price</u> 52.42	Extended Price \$52.42	<u>Taxed Ind</u> N
AH131860	SEAL	1.00	28.43	28.43	\$28.43	Ν
AH21815	SEAL	1.00	14.87	14.87	\$14.87	Ν
CE21767	Shaft Key	2.00	22.89	22.89	\$45.78	Ν
DE20207	BALL BEARING	1.00	35.58	35.58	\$35.58	Ν
JD7689	BALL BEARING	1.00	24.19	24.19	\$24.19	Ν
R69706	LOCK NUT	2.00	3.76	1.88	\$3.76	Ν
TY26373X	oil 80w-140 syn	4.00	15.92	15.92	\$63.68	Ν
Labor: \$575.00	Parts: \$268.71 OL&M: \$0.00	Misc: \$	0.00	Sub-To	otal: \$843.71	

/DIA-1 Warranty

COMPLAINT: Feeder house fore and aft doesn't move.

CORRECTION:

Preformed feeder house fore and aft calibration, no codes returned and is functioning normally.

Labor: \$180.00 Parts: \$0.00	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$180.00
-------------------------------	--------------	--------------	---------------------

/S670G1138876 Warranty

COMPLAINT: Wheel angle sensor codes while harvesting



910 West Highway 36 Smith Center, KS 66967 Phone: 785-282-6601 Fax: 785-282-6958 www.landmarkimp.com Smithcenter@landmarkimp.com



Invoice To Account No:	Deliver To:		SE	ERVICE INVOICE
WARRANTY			Invoice Number:	10032243
			Invoice Date:	3/23/2016
			Location:	03
			Work Order Number:	177978
			Payment Type:	Account
Bus Phone:				
Prv Phone:			Page:	5 of 5
Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE S670	261	1H0S670STF0776360	PF776360	

/S670G1138876 Warranty

Replaced wheel angle sensor in housing and attempted to recalibrate. Diagnose new codes and found wheel angle sensor was faulty. Replaced wheel angle sensor and recalibrated system.

Labor: \$654.63	Parts: \$232.78 OL&M: \$0.00	Misc: \$	\$19.96	Sub-To	otal: \$907.37	
<u>Miscellaneous</u> PT3750	Description FREIGHT JD - PARTS SC	<u>Quantity</u> 1.00	<u>List Price</u> 19.96	<u>Net Price</u> 19.96	Extended Price \$19.96	<u>Taxed Ind</u> N
de20796	Spindle	1.00	143.38	143.38	\$143.38	Ν
AXE11477	SENSOR	1.00	88.90	88.90	\$88.90	Ν
<u>Part Number</u> 34H258	Description SPRING PIN	<u>Quantity</u> 1.00	<u>List Price</u> 0.50	<u>Net Price</u> 0.50	Extended Price \$0.50	<u>Taxed Ind</u> N

INVOICE CONTAINS \$28.18 DISCOUNT

Customer PO No: Tax Exempt No: Advisor:	ON FILE SCOTT KUHN	Labor: Parts: OL&M: Misc: Sales Tax:	\$3,269.63 \$6,617.92 \$0.00 \$19.96 \$0.00
* * * DOC	UMENT COPY * * *	Grand Total:	\$9,907.51

LANDMARK EXCLUSIVE WARRANTY OFFER! We're now offering a 1 year warranty on labor for all non-maintenance items only when work is completed by one of our factory trained John Deere technicians. For parts only purchase over the counter we have a 6 month warranty on John Deere parts.

TERMS AND CONDITIONS

Approved charges are due by the 10th of the month following purchase, I agree to pay a monthly periodic FINANCE CHARGE at the rate of 1.33% which is an ANNUAL PERCENTAGE CHARGE OF 16% on the unpaid balance. The purchaser agrees to pay reasonable attorney fees if collection efforts are required.



910 West Highway 36 Smith Center, KS 66967 Phone: 785-282-6601 Fax: 785-282-6958 www.landmarkimp.com Smithcenter@landmarkimp.com



SERVICE INVOICE Invoice To Account No: Deliver To: **Invoice Number:** 10252718 4/14/2017 Invoice Date: Location: 03 Work Order Number: 219830 Finance Payment Type: Bus Phone: 1 of 6 Prv Phone: Page: Make/Model: Serial Number: Fleet No: Meter: Eq ID: JOHN DEERE S670 677 1H0S670STF0776360 PF776360

/S670AINSP Retail

COMPLAINT:

01 WINTER SERVICE INSPECTION PROGRAM ON COMBINES

CORRECTION:

<u>Part Number</u> DS0251	Description SCAN TEST		<u>Quantity</u> 1.00	List Price 30.33	<u>Net Price</u> 30.03	Extended Price \$30.03	<u>Taxed Ind</u> N
IPSKIT1	SCAN TEST KI		2.00	11.96	11.84	\$23.68	Ν
Labor: \$699.98	Parts: \$53.71	OL&M: \$0.00	Misc: \$	0.02	Sub-To	tal: \$753.71	

/S670G000004 Retail

COMPLAINT:

02 ADJUST ALL BELTS AND CHAINS INCLUDING BOTH ELEVATOR CHAINS / REPLACE FEEDER HOUSE AND TAILINGS DRIVE CHAINS / REMOVE 1/2 LINKS FROM FEEDER HOUSE CONVEYOR CHAIN

CORRECTION:

Adjusted all drive belts and chains. Adjusted both elevator paddle chains. Installed new tailings and feeder house drive chains. Removed 1/2 links from the feeder house conveyor chain.

Labor: \$357.88	Parts: \$133.57	OL&M: \$0.00	Misc: \$	60.00	Sub-To	otal: \$491.45	
AXE28813	LINK CHAIN		1.00	111.04	111.04	\$111.04	N
AE23539	Link Chain		1.00	22.15	21.93	\$21.93	N
<u>Part Number</u> 11M7021	Description COTTER PIN	Contrast of the second	Quantity 2.00	List Price 0.30	Net Price 0.30	Extended Price \$0.60	<u>Taxed Ind</u> N

/S670G1138808 Retail

COMPLAINT:

03 FEED ACCELERATOR WEAR STRIPS FLIP / REPLACE 1 MISSING BOLT

CORRECTION:

Flipped all strips and installed one new bolt.

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
03M7375	BOLT	1.00	1.09	1.08	\$1.08	N



910 West Highway 36 Smith Center, KS 66967 Phone: 785-282-6601 Fax: 785-282-6958 www.landmarkimp.com Smithcenter@landmarkimp.com



	Delive	er 10.						
					Invoice Num	ber:		252718
					Invoice D		4	/14/2017
					Locat			03
					Nork Order Num Payment Ty			219830 Finance
Bus Phone:					raymentry	ype.		1 manoe
Prv Phone:					Pa	ige:		2 of 6
Make/Model:	IL	Meter:	Serial Numb	er:	Eq ID:		Fleet No:	
JOHN DEERE S670		677	1H0S670ST	F0776360	PF776360			
/S670G1138808 Retail								
14M7296	FLANGE NUT			1.00	1.08	1.07	\$1.07	N
Labor: \$332.31	Parts: \$2.15	OL&M:	\$0.00	Misc:	\$0.00	Sub-To	tal: \$334.46	
/S670G1138747 Retail COMPLAINT: 04 FLIP DISCHARGE BEA CORRECTION: Flipped all discharge beater								
COMPLAINT: 04 FLIP DISCHARGE BEA		OL&M:	\$0.00	Misc:	\$0.00	Sub-To	tal: \$204.50	
COMPLAINT: 04 FLIP DISCHARGE BEA CORRECTION: Flipped all discharge beater	Parts: \$0.00 OPPER HAMMERS / FLIF	P STATIONARY	KNIVES		\$0.00	Sub-To	tal: \$204.50	
COMPLAINT: 04 FLIP DISCHARGE BEA CORRECTION: Flipped all discharge beater Labor: \$204.50 /S670G1138937 Retail COMPLAINT: 05 REPLACE STRAW CH CORRECTION:	Parts: \$0.00 OPPER HAMMERS / FLIF	P STATIONARY	KNIVES		\$0.00	Sub-To	tal: \$204.50 Extended Price \$55.80	Taxed Ind N
COMPLAINT: 04 FLIP DISCHARGE BEA CORRECTION: Flipped all discharge beater Labor: \$204.50 /S670G1138937 Retail COMPLAINT: 05 REPLACE STRAW CH CORRECTION: Replaced all chopper hamm Part Number	Parts: \$0.00 OPPER HAMMERS / FLIF hers and hardware. Flipped	P STATIONARY	KNIVES		List Price	Net Price	Extended Price	N
COMPLAINT: 04 FLIP DISCHARGE BEA CORRECTION: Flipped all discharge beater Labor: \$204.50 /S670G1138937 Retail COMPLAINT: 05 REPLACE STRAW CH CORRECTION: Replaced all chopper hamm <u>Part Number</u> 19M7935	• strips. Parts: \$0.00 OPPER HAMMERS / FLIF hers and hardware. Flipped Description CAP SCREW	P STATIONARY	KNIVES	Quantity 30.00	List Price 1.88	<u>Net Price</u> 1.86	Extended Price \$55.80	
COMPLAINT: 04 FLIP DISCHARGE BEA CORRECTION: Flipped all discharge beater Labor: \$204.50 /S670G1138937 Retail COMPLAINT: 05 REPLACE STRAW CH CORRECTION: Replaced all chopper hamm Part Number 19M7935 A51212	Parts: \$0.00 OPPER HAMMERS / FLIF hers and hardware. Flipped Description CAP SCREW LOCK NUT	P STATIONARY	KNIVES	<u>Quantity</u> 30.00	List Price 1.88 0.99	<u>Net Price</u> 1.86 0.98	Extended Price \$55.80 \$29.40	N N N
COMPLAINT: 04 FLIP DISCHARGE BEA CORRECTION: Flipped all discharge beater Labor: \$204.50 /S670G1138937 Retail COMPLAINT: 05 REPLACE STRAW CH CORRECTION: Replaced all chopper hamm <u>Part Number</u> 19M7935 A51212 HXE15909	Parts: \$0.00 Perts: \$0.00 Perts: \$0.00 Perton CAP SCREW LOCK NUT SPACER	P STATIONARY	KNIVES	Quantity 30.00 30.00 44.00	List Price 1.88 0.99 8.24	Net Price 1.86 0.98 8.16	Extended Price \$55.80 \$29.40 \$359.04	N N

/S670G1138957 Retail

COMPLAINT:

06 ADD GREASE HOSES TO CHOPPER BEARINGS



910 West Highway 36 Smith Center, KS 66967 Phone: 785-282-6601 Fax: 785-282-6958 www.landmarkimp.com Smithcenter@landmarkimp.com



SERVICE INVOICE Invoice To Account No: Deliver To: Invoice Number: 10252718 4/14/2017 Invoice Date: Location: 03 Work Order Number: 219830 Finance Payment Type: Bus Phone: 3 of 6 Prv Phone: Page: Make/Model: Meter: Serial Number: Fleet No: Eq ID: PF776360 JOHN DEERE S670 677 1H0S670STF0776360

/S670G1138957 Retail

Removed chopper drive gearcase and installed grease hose. Installed grease zerk on RH chopper bearing and modified bearing cover to allow access to zerk.

	-					
X101CY-2-2	Hose Fitting	2.00	7.86	7.78	\$15.56	Ν
JD7759	LUBRICATION	2.00	0.75	0.74	\$1.48	Ν
F2136R	ELBOW FITTIN	1.00	3.48	3.45	\$3.45	Ν
15H73	COUPLING	1.00	4.07	4.03	\$4.03	Ν
<u>Part Number</u> 100R7	Description	<u>Quantity</u> 1.00	List Price 0.00	<u>Net Price</u> 0.00	Extended Price \$0.00	<u>Taxed Ind</u> N

/S670G1138850 Retail

COMPLAINT:

07 REPLACE RH SEPARATOR RAIL WEAR PLATE AND HARDWARE

CORRECTION:

Removed concaves and rail wear plate installed new plate with new hardware.

HXE10208	Cover	1.00	96.92	95.96	\$95.96	Ν
H207530	Strip	1.00	10.85	10.74	\$10.74	Ν
H174755	BOLT	6.00	1.38	1.36	\$8.17	Ν
<u>Part Number</u> 14M7296	<u>Description</u> FLANGE NUT	Quantity 11.00	List Price 1.08	<u>Net Price</u> 1.07	Extended Price \$11.77	<u>Taxed Ind</u> N

=15

/S670G1138840 Retail

COMPLAINT:

08 REPLACE FEEDER HOUSE RETURN FLOOR WEAR STRIPS

CORRECTION:

Removed upper feeder house dust covers. Replaced all return wear strips. Installed covers.

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind



910 West Highway 36 Smith Center, KS 66967 Phone: 785-282-6601 Fax: 785-282-6958 www.landmarkimp.com Smithcenter@landmarkimp.com



Sub-Total:

\$409.83

SERVICE INVOICE Invoice To Account No: Deliver To: Invoice Number: 10252718 4/14/2017 Invoice Date: Location: 03 Work Order Number: 219830 Finance Payment Type: Bus Phone: 4 of 6 Prv Phone: Page: Make/Model: Meter: Serial Number: Eq ID: Fleet No: JOHN DEERE S670 677 1H0S670STF0776360 PF776360 /S670G1138840 Retail H171960 STRIP 4.00 26.03 25.77 \$103.08 Ν

\$0.00

Misc: \$0.00

Parts: \$103.08

Labor: \$306.75

/S670SERVICE Retail

COMPLAINT:

09 SERVICE: CHANGE ALL AIR FILTERS / CHANGE HYDRAULIC FILTERS / CHANGE FUEL FILTERS / CHANGE ENGINE OIL AND FILTER / CHANGE REVERSER OIL

OL&M:

CORRECTION:

Changed all air, hydraulic and fuel filters. Cleaned fuel sediment bowl. Topped off hydraulic oil reservoir. Changed engine oil and filter. Changed reverser oil

<u>Part Number</u> AH128449	Description HYDRAULIC	<u>Quantity</u> 2.00	<u>List Price</u> 55.90	<u>Net Price</u> 55.35	Extended Price \$110.70	<u>Taxed Ind</u> N
AH170741	COVER	1.00	31.40	31.40	\$31.40	Ν
AN207368	HYDRAULIC	1.00	114.37	114.37	\$114.37	Ν
AT129775	Oil Filter	1.00	78.85	78.07	\$78.07	Ν
AXE42065	FILTER ELE	1.00	43.71	43.28	\$43.28	Ν
AXE42066	FILTER ELE	1.00	92.15	91.24	\$91.24	Ν
HXE11090	Filter	1.00	215.60	215.60	\$215.60	Ν
HXE11091	Filter Element	1.00	146.71	146.71	\$146.71	Ν
L214634	FILTER	1.00	15.59	15.44	\$15.44	Ν
R101042	O-RING	1.00	3.39	3.36	\$3.36	Ν
RE284091	AIR FILTER	1.00	57.22	56.65	\$56.65	Ν
RE509672	FILTER ELEME	1.00	20.61	20.41	\$20.41	Ν
RE533910	FUEL FILTER	1.00	113.48	113.48	\$113.48	Ν
RE539465	FILTER ELE	1.00	89.42	88.53	\$88.53	Ν
RE554498	FILTER	1.00	97.92	96.95	\$96.95	Ν
TY22028	HY-GARD TM	4.00	13.88	13.88	\$55.52	Ν
TY26408	OIL	4.00	19.81	19.61	\$78.44	Ν



910 West Highway 36 Smith Center, KS 66967 Phone: 785-282-6601 Fax: 785-282-6958 www.landmarkimp.com Smithcenter@landmarkimp.com



Sub-Total: \$1,993.08

Invoice To Account No:	Deliver To:				SERV	ICE INVC	DICE
			Inv	voice Numb	er:	102	52718
				Invoice Da	ate:	4/1	14/2017
				Locati	ion:		03
			Work	Order Numb	ber:		219830
				Payment Ty	pe:	F	Finance
Bus Phone:							
Prv Phone:				Pa	ge:		5 of 6
Make/Model:	Meter:	Serial Number:	Eq	ID:		Fleet No:	
JOHN DEERE S670	677	1H0S670STF0776360) PF	776360			
/S670SERVICE Retail TY26682	Plus-50 II Oil 15W40 CJ4/SN	8	3.00	15.21	15.21	\$121.68	N

Misc: \$0.00

/S670G1138826 Retail

Labor: \$511.25

COMPLAINT:

10 SWAP CONCAVES AND SET FOR WHEAT / SEND SMALL WIRE CONCAVES TO BE REPAIRED / REPLACE 2 MISSING SEPARATOR GRATE COVERS

OL&M: \$0.00

Parts: \$1,481.83

CORRECTION:

Sent one small wire concave to be repaired. Removed round bar concaves. Installed and leveled small wire concaves. Installed two missing separator grate covers. Set the machine for wheat.

<u>Part Number</u> AXE50778	<u>Description</u> Cover		<u>Quantity</u> 1.00	List Price 46.74	<u>Net Price</u> 46.28	Extended Price \$46.28	<u>Taxed Ind</u> N
		LAN	DIVIA	B K			
		TIM	PLEMENT	1/-			



910 West Highway 36 Smith Center, KS 66967 Phone: 785-282-6601 Fax: 785-282-6958 www.landmarkimp.com Smithcenter@landmarkimp.com



Invoice To Account No:	Deliv	er To:			SERVICE INVOIO			
					Invoice Numb	er:	1025	52718
					Invoice Da	te:	4/1-	4/2017
					Locatio	on:		03
					Work Order Numb	er:	2	219830
					Payment Typ	be:	Finance	
Bus Phone:								
Prv Phone:					Pag	le:		6 of 6
Make/Model:		Meter:	Serial Number:	/	Eq ID:		Fleet No:	
JOHN DEERE S670		677	1H0S670STF077	6360	PF776360			
/S670G1138826 Retail H156272	NAIL			12.00	5.91	5.91	\$70.92	Ν
OL&M Charges:								
Description REPAIR CONCAVE							\$	<u>Value</u> 738.33
Labor: \$460.14	Parts: \$117.20	OL&M:	\$738.33	Misc	: (\$0.01)	Sub-Total	: \$1,315.66	
	INVOICE CONTAIN	IS \$18.16 DISCO	UNT					

		Finance Information	Labor:	\$3,977.13
Customer PO No:			Parts:	\$3,980.36
Tax Exempt No:	ON FILE KS	Merchant No:	OL&M:	\$738.33
Advisor:	SCOTT KUHN	Card No:	Misc:	\$0.00
			Sales Tax:	\$0.00
* * * DOC	UMENT COPY * * *		Grand Total:	\$8,695.82

LANDMARK EXCLUSIVE WARRANTY OFFER! We're now offering a 1 year warranty on labor for all non-maintenance items only when work is completed by one of our factory trained John Deere technicians. For parts only purchase over the counter we have a 6 month warranty on John Deere parts.

TERMS AND CONDITIONS

This purchase(s) is subject to the terms of the Multi-Use Account, a service of John Deere Financial, f.s.b. I grant the issuer a purchase money security interest, except as limited in that agreement, in the goods described.



910 West Highway 36 Smith Center, KS 66967 Phone: 785-282-6601 Fax: 785-282-6958 www.landmarkimp.com Smithcenter@landmarkimp.com



SERVICE INVOICE

Invoice To Account No:	Deliver To:		SERVICE INVOICE				
WARRANTY			Invoice Number:	10268066			
			Invoice Date:	5/3/2017			
			Location:	03			
			Work Order Number:	219774			
			Payment Type:	Account			
Bus Phone:							
Prv Phone:			Page:	1 of 6			
Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:			
JOHN DEERE S670	675	1H0S670STF0776360	PF776360				

/S670G1138900 Warranty

COMPLAINT:

01 REPLACE FRONT CHAFFER FRAME LINKS

CORRECTION:

Replaced both front chaffer frame links and torqued hardware to spec.

<u>Part Number</u> 14M7291	<u>Description</u> FLANGE NUT	<u>Quantity</u> 2.00	List Price 2.35	<u>Net Price</u> 2.33	Extended Price \$4.66	<u>Taxed Ind</u> N
19M8486	CAP SCREW	2.00	8.61	8.52	\$17.04	Ν
AH219844	ARM	1.00	195.19	195.19	\$195.19	Ν
AH219846	ARM	1.00	195.19	195.19	\$195.19	Ν
Labor: \$107.36	Parts: \$412.08 OL&M: \$0.00	Misc: \$	0.00	Sub-Tota	al: \$519.44	

/S670G1138893 Warranty

COMPLAINT: 02 REPLACE FRONT SIEVE FRAME LINKS

CORRECTION:

Removed chaffer and sieve elements. Removed fixed front chaffer. Removed all chaffer frame hardware. Removed chaffer frame. Replaced front sieve frame links and torqued hardware to spec. Installed components in reverse order and torqued all mounting hardware to spec. Calibrated chaffer and sieve frame openings.

Labor: \$1,227.00	Parts: \$284.56	OL&M: \$0.00	Misc: \$	\$0.00	Sub-To	otal: \$1,511.5	6
H227582	Bolt	- West	2.00	9.62	9.52	\$19.04	Ν
AXE16294	ARM		2.00	130.43	130.43	\$260.86	Ν
<u>Part Number</u> 14M7291	<u>Description</u> FLANGE NUT		Quantity 2.00	List Price 2.35	Net Price 2.33	Extended Price \$4.66	<u>Taxed Ind</u> N

/S670G1138832 Warranty

COMPLAINT: 03 REPLACE SHOE CROSS SHAFT BEARINGS



910 West Highway 36 Smith Center, KS 66967 Phone: 785-282-6601 Fax: 785-282-6958 www.landmarkimp.com Smithcenter@landmarkimp.com



SERVICE INVOICE Invoice To Account No: Deliver To: WARRANTY **Invoice Number:** 10268066 5/3/2017 Invoice Date: Location: 03 Work Order Number: 219774 Account Payment Type: Bus Phone: 2 of 6 Prv Phone: Page: Make/Model: Meter: Serial Number: Eq ID: Fleet No: JOHN DEERE S670 675 1H0S670STF0776360 PF776360

/S670G1138832 Warranty

Removed shoe pitman bearings. Replaced cross shaft bearings, flanges and lock collars. Checked for correct shaft placement. Installed pitman bearings.

<u>Part Number</u> AL14674	Description ECCENTRIC		<u>Quantity</u> 2.00	List Price 13.01	<u>Net Price</u> 12.88	Extended Price \$25.76	<u>Taxed Ind</u> N
AXE61820	BALL BEARI		2.00	61.97	61.36	\$122.72	Ν
H133621	PRESSED FL		4.00	9.76	9.66	\$38.64	Ν
Labor: \$153.38	Parts: \$187.12	OL&M: \$0.00	Misc: \$	0.00	Sub-To	tal: \$340.50	

/S670G1138812 Warranty

COMPLAINT:

04 REPLACE FRONT SEPARATOR DRIVE LINE AND CARRIER BEARING

CORRECTION:

Removed both halves of the separator drive line and sent them out to be repaired. The front shaft was .020 out of spec. The rear shaft was .040 out of spec. Installed new carrier bearing. Installed shaft. Submitted a DTAC report only with our results.

<u>Part Number</u> AH207922	Description UNIVERSAL	T IMPLIER	Quantity 1.00	List Price 121.42	<u>Net Price</u> <u>1</u> 121.42	Extended Price \$121.42	<u>Taxed Ind</u> N
AH229100	BEARING KIT		1.00	134.54	134.54	\$134.54	Ν
R85169	SCREW		8.00	1.77	1.75	\$14.00	Ν
• · · · • • • · · =	N DRIVELINE N DRIVELINE						<u>Value</u> \$174.00 \$217.50
Labor: \$357.8	8 Parts: \$269.96	OL&M: \$391.50	Misc: \$	60.00	Sub-Tota	ıl: \$1,019.3	4

/S670G1138948 Warranty

COMPLAINT: 05 REPLACE LH OUTER TIE ROD END



910 West Highway 36 Smith Center, KS 66967 Phone: 785-282-6601 Fax: 785-282-6958 www.landmarkimp.com Smithcenter@landmarkimp.com



SERVICE INVOICE Invoice To Account No: Deliver To: WARRANTY Invoice Number: 10268066 5/3/2017 Invoice Date: Location: 03 Work Order Number: 219774 Account Payment Type: Bus Phone: 3 of 6 Prv Phone: Page: Make/Model: Meter: Serial Number: Eq ID: Fleet No: JOHN DEERE S670 675 1H0S670STF0776360 PF776360

/S670G1138948 Warranty

Lifted LH side of rear axle. Removed tie rod. Installed new tie rod and checked for correct toe in. Lowered combine.

<u>Part Number</u> 11M7087	Description COTTER PIN		<u>Quantity</u> 1.00	List Price 0.33	<u>Net Price</u> 0.33	Extended Price \$0.33	<u>Taxed Ind</u> N
14H1086	NUT		1.00	5.49	5.44	\$5.44	Ν
AH231494	TIE ROD END		1.00	171.31	171.31	\$171.31	Ν
Labor: \$102.25	Parts: \$177.08	OL&M: \$0.00	Misc: \$	\$0.00	Sub-To	otal: \$279.33	

/S670G1138863 Warranty

COMPLAINT: 06 REPLACE MOISTURE SENSOR GASKET

CORRECTION:

Removed moisture sensor and cleaned surfaces. Installed new gasket with sealant. Installed moisture sensor.

<u>Part Number</u> H154379	Description SEALANT	ANDI	Quantity 1.00	List Price 14.96	Net Price 14.81	Extended Price \$14.81	<u>Taxed Ind</u> N
HXE16935	GASKET	NIPLE	1.00	31.34	31.03	\$31.03	Ν
Labor: \$132.93	Parts: \$45.84	OL&M: \$0.00	Misc: \$	0.00	Sub-To	otal: \$178.77	

/S670G1138845 Warranty

COMPLAINT:

07 REPLACE FEEDER HOUSE FORE AND AFT FRAME SEAL

CORRECTION:

Removed old seal and cleaned residue from mating surfaces. Installed new seal.

<u>Part Number</u>	Description		<u>Quantity</u>	List Price	<u>Net Price</u>	Extended Price	<u>Taxed Ind</u>
HXE84785	Isolator		1.00	35.09	35.09	\$35.09	N
Labor: \$76.69	Parts: \$35.09	OL&M: \$0.00	Misc: \$	0.00	Sub-To	tal: \$111.78	

/S670G1138887 Warranty



910 West Highway 36 Smith Center, KS 66967 Phone: 785-282-6601 Fax: 785-282-6958 www.landmarkimp.com Smithcenter@landmarkimp.com



Invoice To Account No:	Deliver To:		SERVICE INVOID			
WARRANTY			Invoice Number:	10268066		
			Invoice Date:	5/3/2017		
			Location:	03		
			Work Order Number:	219774		
			Payment Type:	Account		
Bus Phone:						
Prv Phone:			Page:	4 of 6		
Make/Model:	Meter	: Serial Number:	Eq ID:	Fleet No:		
JOHN DEERE S670	675	1H0S670STF0776360) PF776360			

/S670G1138887 Warranty

08 REPLACE BROKEN BOLT ON FEEDER HOUSE FORE AND AFT FRAME PIN

CORRECTION:

Removed LH tilt cylinder to gain access to bolt. Could not get a good angle to drill bolt out with tilt frame in place. Removed tilt frame. Drilled out broken bolt and tapped threads. Found that the pivot pin had worked out of position and had to be drove back in. Installed new bolt with thread locker. Also replaced bolt on RH side of feeder house because it was working loose. Installed face frame and torqued mounting bolts. Installed tilt cylinders.

<u>Part Number</u> 19M7784	Description SCREW		<u>Quantity</u> 2.00	List Price 0.96	<u>Net Price</u> 0.96	Extended Price \$1.92	<u>Taxed Ind</u> N
19M7844	SCREW		8.00	2.81	2.78	\$22.24	Ν
19M7865	SCREW		2.00	0.79	0.78	\$1.56	Ν
Labor: \$357.88	Parts: \$25.72	OL&M: \$0.00	Misc: \$	0.00	Sub-To	otal: \$383.60	

/S670G1138871 Warranty

COMPLAINT: 09 DIAGNOSE AND REPAIR FOR ECU 4341.06 (DEF LINE HEATER)

CORRECTION:

Followed diagnostics on Service Advisor for ECU 4341.06 and it lead me to replace the DEF Pressure heater line. After replacing line the machine now had a different DTC (ECU 4341.05) than before. Followed diagnostics and tested all wiring. After submitting and DTAC case they lead me in a new direction and had me perform a harness mode test. After connecting to machine and performing test the code still returned. Continued test wiring and connectors. Removed ECU and its connectors to check terminals. Found no issues. Cleaned all connections and installed ECU. Performed harness mode check once more and this time code did not return. Determined that the cause of the second code was due to a poor connection.

Labor: \$766.89	Parts: \$216.16	OL&M: \$0.00	Misc:	(\$0.01)	Sub-To	otal: \$983.04	
RE560898	DEF Line		1.00	210.22	210.22	\$210.22	Ν
<u>Part Number</u> M131313	<u>Description</u> Clip		<u>Quantity</u> 6.00	<u>List Price</u> 0.99	<u>Net Price</u> 0.99	Extended Price \$5.94	<u>Taxed Ind</u> N

/S670G1138861 Warranty

COMPLAINT:

12 DIAGNOSE AND REPAIR FOR LC1 516336.20 & 516724.07 (FEEDER HOUSE FORE AND AFT SENSOR)



910 West Highway 36 Smith Center, KS 66967 Phone: 785-282-6601 Fax: 785-282-6958 www.landmarkimp.com Smithcenter@landmarkimp.com



SERVICE INVOICE Invoice To Account No: Deliver To: WARRANTY **Invoice Number:** 10268066 5/3/2017 Invoice Date: Location: 03 Work Order Number: 219774 Payment Type: Account Bus Phone: 5 of 6 Prv Phone: Page: Make/Model: Serial Number: Fleet No: Meter: Eq ID: JOHN DEERE S670 675 1H0S670STF0776360 PF776360

/S670G1138861 Warranty

CORRECTION:

Followed diagnostics in Service Advisor and it lead me to replace the position sensor. Replaced sensor and performed calibration. Code did not return.

<u>Part Number</u> AXE14245	Description Sensor		<u>Quantity</u> 1.00	<u>List Price</u> 116.97	<u>Net Price</u> 116.97	Extended Price \$116.97	<u>Taxed Ind</u> N
AXE14888	Shaft		1.00	26.62	26.36	\$26.36	Ν
P48347	O-RING		1.00	1.32	1.31	\$1.31	Ν
Labor: \$51.13	Parts: \$144.64	OL&M: \$0.00	Misc: \$	0.00	Sub-To	otal: \$195.77	

/S670G1138946 Warranty COMPLAINT:

13 DIAGNOSE AND REPAIR FOR MULTIPLE SSU CODES (REPLACE STEERING WHEEL POSITION SENSOR)

CORRECTION:

Followed diagnostics in Service Advisor and it lead me to replace the steering wheel position sensor. Removed EH steering valve and replaced sensor. Performed SSU calibration and code did not return.

Part Number	Description		<u>Quantity</u>	List Price	<u>Net Price</u>	Extended Price	<u>Taxed Ind</u>
AL206976	Sensor		1.00	157.91	157.91	\$157.91	N
Labor: \$204.50	Parts: \$157.91	OL&M: \$0.00	Misc:	\$0.00	Sub-To	otal: \$362.41	

/S670DUSPACE Warranty

COMPLAINT:

14 REPLACE SHOE PITMAN ARM BEARINGS ON BOTH SIDES

CORRECTION:

Removed shoe drive belt and flywheel. Removed pitman bearing assemblies and disassembled. Replaced bearings and flanges. Installed bear assemblies and torgued all mounting hardware. Installed flywheel and shoe drive belt.

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
AH125975	BALL BEARI	4.00	106.60	106.60	\$426.40	N



910 West Highway 36 Smith Center, KS 66967 Phone: 785-282-6601 Fax: 785-282-6958 www.landmarkimp.com Smithcenter@landmarkimp.com



Invoice To Account No:	Deliver	To:				SERVIC	E INVC	DICE
WARRANTY				,	Invoice Numb Invoice D Locat Work Order Num Payment Ty	ate: ion: ber:	5	68066 /3/2017 03 219774 Account
Bus Phone: Prv Phone:						ige:		6 of 6
Make/Model:		Meter:	Serial Number:		Eq ID:	F	leet No:	
JOHN DEERE S670		675	1H0S670STF077	6360	PF776360			
/S670DUSPACE Warranty H134118	PRESSED FL			8.00	17.23	17.23	\$137.84	N
Labor: \$265.85	Parts: \$564.24	OL&M:	\$0.00	Misc:	\$0.00	Sub-Total:	\$830.09	
	INVOICE CONTAINS	\$3.54 DISCOU	NT			Labor: Parts: OL&M:	\$2, \$	803.73 520.40 391.50
Advisor: SCOT	TKUHN					Misc: Sales Tax:		\$0.00 \$0.00
* * * DOCUMENT						Grand Total:	<u>\$6,</u>	715.63

LANDMARK EXCLUSIVE WARRANTY OFFER! We're now offering a 1 year warranty on labor for all non-maintenance items only when work is completed by one of our factory trained John Deere technicians. For parts only purchase over the counter we have a 6 month warranty on John Deere parts.

TERMS AND CONDITIONS

Approved charges are due by the 10th of the month following purchase, I agree to pay a monthly periodic FINANCE CHARGE at the rate of 1.33% which is an ANNUAL PERCENTAGE CHARGE OF 16% on the unpaid balance. The purchaser agrees to pay reasonable attorney fees if collection efforts are required.



910 West Highway 36 Smith Center, KS 66967 Phone: 785-282-6601 Fax: 785-282-6958 www.landmarkimp.com Smithcenter@landmarkimp.com



Invoice To Account No:	Deliver To:		SERVICE INVOICE			
			Invoice Number:	10388949		
			Invoice Date:	11/20/2017		
			Location:	03		
			Work Order Number:	245995		
			Payment Type:	Finance		
Bus Phone:						
Prv Phone:			Page:	1 of 1		
Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:		
JOHN DEERE S670	946	1H0S670STF0776360	PF776360			

/S670SERVCALL Retail

COMPLAINT:

SERVICE CALL / Chopper belts 01

CORRECTION:

went out and replaced upper chopper belt and straightened the unloading auger bracket. also had customer run to town to get a hydo hose fixed that was leaking down by valve stack that was for unloading auger.

<u>Part Number</u> H241230	<u>Description</u> V-Belt		QuantityList Pr1.00437.		Ind N
Labor: \$304.91	Parts: \$437.81	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$742.72	

	Finance Information	Labor:	\$304.91
Customer PO No:	VV.	Parts:	\$437.81
Tax Exempt No: ON FILE KS	Merchant No:	OL&M:	\$0.00
Advisor: DWAYNE LORENCE	Card No:	Misc:	\$0.00
	TAINTEANALAIR	Sales Tax:	\$0.00
*** DOCUMENT COPY ***		Grand Total:	\$742.72

LANDMARK EXCLUSIVE WARRANTY OFFER! We're now offering a 1 year warranty on labor for all non-maintenance items only when work is completed by one of our factory trained John Deere technicians. For parts only purchase over the counter we have a 6 month warranty on John Deere parts.

TERMS AND CONDITIONS

This purchase(s) is subject to the terms of the Multi-Use Account, a service of John Deere Financial, f.s.b. I grant the issuer a purchase money security interest, except as limited in that agreement, in the goods described.



910 West Highway 36 Smith Center, KS 66967 Phone: 785-282-6601 Fax: 785-282-6958 www.landmarkimp.com Smithcenter@landmarkimp.com



SERVICE INVOICE

Invoice To Account No:	Deliver To:		SEI	RVICE INVOICE
			Invoice Number:	10449674
			Invoice Date:	4/17/2018
			Location:	03
			Work Order Number:	258147
			Payment Type:	Finance
Bus Phone:				
Prv Phone:			Page:	1 of 6
Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE S670	968	1H0S670STF0776360	PF776360	

/S670AINSP Retail

COMPLAINT:

01 WINTER SERVICE INSPECTION PROGRAM ON COMBINES

CORRECTION:

inspect combine make list of needed repairs and parts.

<u>Part Number</u> DS0251	Description SCAN TEST		<u>Quantity</u> 1.00	List Price 30.33	Net Price 30.33	Extended Price \$30.33	<u>Taxed Ind</u> N
IPSKIT1	SCAN TEST KI		2.00	11.96	11.96	\$23.92	Ν
Labor: \$699.99	Parts: \$54.25	OL&M: \$0.00	Misc: \$	\$0.01	Sub-Tota	al: \$754.25	

/S670G1138802 Retail

COMPLAINT: 02* ADJUST FEEDER HOUSE DRIVE CHAIN ADJUST FEEDER HOUSE CONVEYOR CHAIN **REMOVE 1/2 LINK FROM CLEAN GRAIN CONVEYOR CHAIN** REMOVE 1/2 LINK FROM TAILINGS ELEVATOR CHAIN REPLACE BOLT ON CLEAN GRAIN ELEVATOR CHAIN ADJUSTMENT AND REPAIR BRACKET REPLACE TOP RETURN FLOOR STRIPS

CORRECTION:

adjust drive chains and removed half link from tailing paddle chain. repaired adjustment bracket for clean grain elevator paddle chain. adjusted paddle chain. adjusted feeder house conveyor chain.

Labor: \$856.21	Parts: \$89.07	OL&M:	\$0.00	Misc:	\$0.00	Sub-To	otal: \$945.28	
H84026	НООК			4.00	0.40	0.40	\$1.60	Ν
H171960	STRIP			4.00	19.87	19.87	\$79.48	Ν
19M8241	CAP SCREW			1.00	2.29	2.29	\$2.29	Ν
19M7783	SCREW			3.00	0.86	0.86	\$2.58	Ν
<u>Part Number</u> 14M7296	<u>Description</u> FLANGE NUT			Quantity 3.00	List Price 1.04	<u>Net Price</u> 1.04	Extended Price \$3.12	<u>Taxed Ind</u> N

/S670G1138969 Retail

COMPLAINT:



910 West Highway 36 Smith Center, KS 66967 Phone: 785-282-6601 Fax: 785-282-6958 www.landmarkimp.com Smithcenter@landmarkimp.com



SERVICE INVOICE Invoice To Account No: Deliver To: Invoice Number: 10449674 4/17/2018 Invoice Date: Location: 03 Work Order Number: 258147 Finance Payment Type: Bus Phone: 2 of 6 Prv Phone: Page: Make/Model: Meter: Serial Number: Eq ID: Fleet No: PF776360 JOHN DEERE S670 968 1H0S670STF0776360

/S670G1138969 Retail

03 REPLACE ELECTRICAL CONNECTOR END ON SINGLE POINT

CORRECTION:

replaced connector on single point. also replaced several pins on wires.

<u>Part Number</u> 24M7226	Description WASHER	<u>Quantity</u> 3.00	<u>List Price</u> 1.85	<u>Net Price</u> 1.85	Extended Price \$5.55	<u>Taxed Ind</u> Y
57M11370	Elec. Connector Housing	1.00	361.30	361.30	\$361.30	Ν
57M7542	ELEC. CONNEC	7.00	1.46	1.46	\$10.22	Ν
57M7546	Elec. Connector Terminal	11.00	0.94	0.94	\$10.34	Ν
Labor: \$239.50	Parts: \$387.41 OL&M: \$0.00	Misc: \$	60.00	Sub-To	otal: \$626.91	

/S670G1138808 Retail

COMPLAINT: 04* FEED ACCELERATOR WEAR STRIPS, R&R

CORRECTION:

DO NOT DO PER CUSTOMER

Labor:	\$0.00	Parts: \$0.00	OL&M:	\$0.00	Misc:	\$0.00	Sub-To	otal: \$0.00	
/ S670G1138 COMPLAINT 05 REPLACI	:	FLOOR BOLTS							
CORRECTIC replaced bolts		floor							
<u>Part Numbe</u> 03M7184		Description BOLT			<u>Quantity</u> 6.00	List Price 0.61	<u>Net Price</u> 0.61	Extended Price \$3.66	<u>Taxed Ind</u> N
Labor:	\$155.68	Parts: \$3.66	OL&M:	\$0.00	Misc:	\$0.00	Sub-To	otal: \$159.34	



910 West Highway 36 Smith Center, KS 66967 Phone: 785-282-6601 Fax: 785-282-6958 www.landmarkimp.com Smithcenter@landmarkimp.com



Invoice To Account No:	Deliver To:			SERVICE INVOI	E
			Invoice Numbe	er: 10449	574
			Invoice Dat	te: 4/17/2	018
			Locatio	in:	03
			Work Order Numbe	er: 258	147
			Payment Typ	e: Fina	ince
Bus Phone:					
Prv Phone:			Page	e: 3	of 6
Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:	
JOHN DEERE S670	968	1H0S670STF0776360	PF776360		
/S670G1138952 Retail					
COMPLAINT: 06 ADJUST GULL WING DOOR LATCH CORRECTION: adjust flag pole on engine access door.					
06 ADJUST GULL WING DOOR LATCH	0 OL&M:	\$0.00 Mis	c: \$0.00	Sub-Total: \$59.88	
06 ADJUST GULL WING DOOR LATCH CORRECTION: adjust flag pole on engine access door.	0 OL&M:	\$0.00 Mis	c: \$0.00	Sub-Total: \$59.88	
06 ADJUST GULL WING DOOR LATCH CORRECTION: adjust flag pole on engine access door. Labor: \$59.88 Parts: \$0.00 /S670G1138739 Retail COMPLAINT: 07 GREASE ROTOR DRIVE SHEAVE GREASE CHOPPER JACKSHAFT	0 OL&M:	\$0.00 Mis	c: \$0.00	Sub-Total: \$59.88	
06 ADJUST GULL WING DOOR LATCH CORRECTION: adjust flag pole on engine access door. Labor: \$59.88 Parts: \$0.00 /S670G1138739 Retail COMPLAINT: 07 GREASE ROTOR DRIVE SHEAVE GREASE CHOPPER JACKSHAFT GREASE ENGINE FAN DRIVE				Sub-Total: \$59.88	
06 ADJUST GULL WING DOOR LATCH CORRECTION: adjust flag pole on engine access door. Labor: \$59.88 Parts: \$0.00 /S670G1138739 Retail COMPLAINT: 07 GREASE ROTOR DRIVE SHEAVE GREASE CHOPPER JACKSHAFT GREASE ENGINE FAN DRIVE CORRECTION: greases rotor drive and chopper jackshaft. gr				Sub-Total: \$59.88	
06 ADJUST GULL WING DOOR LATCH CORRECTION: adjust flag pole on engine access door. Labor: \$59.88 Parts: \$0.00 /S670G1138739 Retail COMPLAINT: 07 GREASE ROTOR DRIVE SHEAVE GREASE CHOPPER JACKSHAFT GREASE ENGINE FAN DRIVE CORRECTION: greases rotor drive and chopper jackshaft. gr Part Number Description		reased the whole combine	ty List Price	Net Price Extended Price Tax	
06 ADJUST GULL WING DOOR LATCH CORRECTION: adjust flag pole on engine access door. Labor: \$59.88 Parts: \$0.00 /S670G1138739 Retail COMPLAINT: 07 GREASE ROTOR DRIVE SHEAVE GREASE CHOPPER JACKSHAFT GREASE ENGINE FAN DRIVE CORRECTION: greases rotor drive and chopper jackshaft. gr		reased the whole combine	ty List Price	-	ed Ind N

/S670G1138984 Retail

COMPLAINT:

08 REPAIR RH POWER FOLD GRAIN TANK DOOR

CORRECTION:

DO NOT REPLACE GRAIN TANK FOLD DOOR PER CUSTOMER

went to maxwells welding and got iron to make repair on door. Used drill press to drill holes in strap iron. drilled holes in door and had Jesse help me install straps on door. painted straps and tested operation.

<u>Part Number</u> 14M7396	Description LOCK NUT	<u>Quantity</u> 10.00	<u>List Price</u> 0.86	<u>Net Price</u> 0.86	Extended Price \$8.60	<u>Taxed Ind</u> N
19M7898	SCREW	10.00	4.86	4.86	\$48.60	Y
TY22032	LUBRICANT	1.00	10.30	10.30	\$10.30	Y



910 West Highway 36 Smith Center, KS 66967 Phone: 785-282-6601 Fax: 785-282-6958 www.landmarkimp.com Smithcenter@landmarkimp.com



SERVICE INVOICE Invoice To Account No: Deliver To: Invoice Number: 10449674 4/17/2018 Invoice Date: Location: 03 Work Order Number: 258147 Finance Payment Type: Bus Phone: 4 of 6 Prv Phone: Page: Make/Model: Meter: Serial Number: Eq ID: Fleet No: JOHN DEERE S670 968 1H0S670STF0776360 PF776360 /S670G1138984 Retail **GREEN SPRAY** 1.00 10.17 10.17 Ν TY25624 \$10.17 OL&M: Labor: \$479.00 Parts: \$77.67 \$0.00 Misc: \$0.00 Sub-Total: \$556.67

/S670SERVICE Retail

COMPLAINT: 09* SERVICE CHANGE ENGINE OIL AND FILTER CHANGE FUEL FILTERS CHANGE HYDRAULIC AND MAIN ENGINE GEAR CASE FILTERS CHANGE PRIMARY COUNTER SHAFT GEAR CASE OIL CHANGE REVERSE OIL CHANGE ALL AIR FILTER

CORRECTION:

DO NOT DO PARTS ONLY PER CUSTOMER

<u>Part Number</u> AH128449	Description HYDRAULIC		Quantity 2.00	List Price 52.35	Net Price 52.35	Extended Price \$104.70	<u>Taxed Ind</u> N
AN207368	HYDRAULIC		1.00	77.65	77.65	\$77.65	Ν
AT129775	Oil Filter		1.00	77.45	77.45	\$77.45	Ν
AXE42065	FILTER ELE		1.00	45.45	45.45	\$45.45	Ν
AXE42066	FILTER ELE		1.00	85.78	85.78	\$85.78	Ν
HXE11090	Filter		1.00	198.66	198.66	\$198.66	Ν
HXE11091	Filter Element		1.00	135.16	135.16	\$135.16	Ν
L214634	FILTER	1 and 1	1.00	15.82	15.82	\$15.82	Ν
N309233	O-RING		1.00	6.76	6.76	\$6.76	Ν
R101042	O-RING		1.00	3.39	3.39	\$3.39	Ν
RE284091	AIR FILTER		1.00	57.90	57.90	\$57.90	Ν
RE509672	FILTER ELEME		1.00	18.71	18.71	\$18.71	Ν
RE533910	FUEL FILTER		1.00	115.83	115.83	\$115.83	Ν
RE539465	FILTER ELE		1.00	93.36	93.36	\$93.36	Ν
RE554498	FILTER		1.00	100.81	100.81	\$100.81	Ν



910 West Highway 36 Smith Center, KS 66967 Phone: 785-282-6601 Fax: 785-282-6958 www.landmarkimp.com Smithcenter@landmarkimp.com



SERVICE INVOICE Invoice To Account No: Deliver To: Invoice Number: 10449674 Invoice Date: 4/17/2018 Location: 03 Work Order Number: 258147 Finance Payment Type: Bus Phone: 5 of 6 Prv Phone: Page: Make/Model: Meter: Serial Number: Fleet No: Eq ID: 1H0S670STF0776360 PF776360 JOHN DEERE S670 968 /S670SERVICE Retail OIL 2.00 22.59 22.59 \$45.18 Ν TY26372 TY26408 OIL 4.00 20.01 20.01 \$80.04 Ν Labor: \$0.00 Parts: \$1,262.65 OL&M: \$0.00 Misc: \$0.00 Sub-Total: \$1,262.65

/HSOFT Retail COMPLAINT:

10* COMBINE SOFTWARE EVALUATION AND UPDATE

CORRECTION:

Justin- I hooked up to the tractor with an EDL and then downloaded the software on my computer and then downloaded it on to the combine.

Labor: \$100.01	Parts: \$0.00	OL&M: \$0.00	Misc: (\$0.01)	Sub-To	otal: \$100.00	
/ S670F1028265 Retail COMPLAINT:	1	AND	ИA	RK			
11 REPLACE MISSING HA	RDWARE ON HYDRO DR	IVE HOSE CLAMPS	MENT				
CORRECTION: nstalled missing hardware	on hose clamps						
<u>Part Number</u> 14M7298	<u>Description</u> FLANGE NUT		Quantity 2.00	List Price 0.76	<u>Net Price</u> 0.76	Extended Price \$1.52	<u>Taxed Ind</u> N
19M8039	SCREW		2.00	2.68	2.68	\$5.36	Ν
24M7298	WASHER	- We	2.00	0.66	0.66	\$1.32	Ν
Labor: \$59.88	Parts: \$8.20	OL&M: \$0.00	Misc: \$	0.00	Sub-To	otal: \$68.08	

/S670G1138826 Retail

COMPLAINT: 12 CONCAVE, R&R - INCLUDES LEVELING SET FOR WHEAT



910 West Highway 36 Smith Center, KS 66967 Phone: 785-282-6601 Fax: 785-282-6958 www.landmarkimp.com Smithcenter@landmarkimp.com



Invoice To Account No:	Deliver To:			SERVICE INVO		
				Invoice Number:	10449674	
				Invoice Date:	4/17/2018	
				Location:	03	
				Work Order Number:	258147	
				Payment Type:	Finance	
Bus Phone:						
Prv Phone:				Page:	6 of 6	
Make/Model:	Met	ter:	Serial Number:	Eq ID:	Fleet No:	
JOHN DEERE S670	968	3	1H0S670STF0776360	PF776360		

/S670G1138826 Retail

removed round bar concaves and installed small wire concaves. leveled concaves and set combine for wheat.

	Labor: \$419.13	Parts: \$0.00	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$419.13
--	-----------------	---------------	--------------	--------------	---------------------

		Fi	inance Information	Labor:	\$3,488.41
Customer PO No:				Parts:	\$1,889.23
Tax Exempt No:	ON FILE KS	м	lerchant No:	OL&M:	\$0.00
Advisor:	SCOTT KUHN	c	ard No:	Misc:	\$0.00
		В	ill Code: 784 -	Sales Tax:	\$5.48
* * * DOC	UMENT COPY * * *	c	redit Plan: 11395 -	Grand Total:	\$5,383.12



LANDMARK EXCLUSIVE WARRANTY OFFER! We're now offering a 1 year warranty on labor for all non-maintenance items only when work is completed by one of our factory trained John Deere technicians. For parts only purchase over the counter we have a 6 month warranty on John Deere parts.

TERMS AND CONDITIONS

This purchase(s) is subject to the terms of the Multi-Use Account, a service of John Deere Financial, f.s.b. I grant the issuer a purchase money security interest, except as limited in that agreement, in the goods described.



910 West Highway 36 Smith Center, KS 66967 Phone: 785-282-6601 Fax: 785-282-6958 www.landmarkimp.com Smithcenter@landmarkimp.com



SERVICE INVOICE Invoice To Account No: Deliver To: WARRANTY **Invoice Number:** 10471354 5/11/2018 Invoice Date: Location: 03 Work Order Number: 258350 Payment Type: Account Bus Phone: 1 of 6 Prv Phone: Page: Make/Model: Meter: Serial Number: Fleet No: Eq ID: JOHN DEERE S670 1H0S670STF0776360 PF776360

/9760STSF1112888 Warranty

COMPLAINT: 01* REPLACE SHOE AUGER BULK HEAD noise from front of combine

CORRECTION:

Removed shoe augers and shoe auger pan. cut hole in LH side of combine to let bulk head drop down. removed bulk head and replaced bulk head and seal. installed shoe auger pan and shoe augers. installed cross shaft and set shoe auger bevel gear backlash.

Part Number 14M7298 Description FLANGE NUT Description FLANGE NUT Quantity 16.00 List Price 0.76 Net Price 0.76 Extended Price \$12.16 Taxed Ind N 19M7866 SCREW 16.00 0.87 0.87 \$13.92 N AH80335 WEATHERSTR 8.00 5.42 5.42 \$43.36 N AXE48816 CHANNEL 1.00 386.40 \$386.40 N	Labor: \$1,544.78	Parts: \$455.84	OL&M: \$0.00	Misc:	50.00	Sub-Tot	al: \$2,000.6	2
14M7298 FLANGE NUT 16.00 0.76 0.76 \$12.16 N 19M7866 SCREW 16.00 0.87 0.87 \$13.92 N	AXE48816	CHANNEL		1.00	386.40	386.40	\$386.40	Ν
14M7298 FLANGE NUT 16.00 0.76 0.76 \$12.16 N	AH80335	WEATHERSTR		8.00	5.42	5.42	\$43.36	Ν
	19M7866	SCREW		16.00	0.87	0.87	\$13.92	Ν

/S670G000013 Warranty

COMPLAINT:

02* REPLACE COUPLER ON MULTI-COUPLER - PRICING PER COUPLER

oil leak on single point

CORRECTION:

replaced one fore and aft coupler on combine side of single point.

Labor: \$47.90	Parts: \$146.01	OL&M: \$0.00	Misc: \$	0.00	Sub-To	otal: \$193.91	
<u>Part Number</u>	Description		<u>Quantity</u>	<u>List Price</u>	<u>Net Price</u>	Extended Price	<u>Taxed Ind</u>
AXE21789	VALVE		1.00	146.01	146.01	\$146.01	N

/S670G1138946 Warranty

COMPLAINT: 03 STEERING PUMP SUPPLY HOSE LEAKING oil leak on LH side of combine

CORRECTION:



910 West Highway 36 Smith Center, KS 66967 Phone: 785-282-6601 Fax: 785-282-6958 www.landmarkimp.com Smithcenter@landmarkimp.com



SERVICE INVOICE Invoice To Account No: 1004 Deliver To: WARRANTY **Invoice Number:** 10471354 5/11/2018 Invoice Date: Location: 03 Work Order Number: 258350 Account Payment Type: Bus Phone: 2 of 6 Prv Phone: Page: Make/Model: Meter: Serial Number: Eq ID: Fleet No: JOHN DEERE S670 1H0S670STF0776360 PF776360

/S670G1138946 Warranty

drained oil out of main engine gear case. replaced hose on steering pump supply and prodrive pump supply hoses. filled gear case with oil and tested operation

Labor: \$329	9.31 Parts: \$380.68	OL&M: \$0.00 Misc:	\$0.00	Sub-Total:	\$709.99	
TY26101	BRAKE/CLUTCH	2.00	4.97	4.97	\$9.94	Ν
T78612	O-RING	3.00	2.24	2.24	\$6.72	Ν
T76938	O-RING	1.00	2.00	2.00	\$2.00	Ν
AXE27393	Hydraulic Hose	1.00	211.91	211.91	\$211.91	Ν
<u>Part Number</u> AXE24936	Description Hydraulic Hose	<u>Quantity</u> 1.00	<u>List Price</u> 150.11	<u>Net Price</u> <u>Ex</u> 150.11	tended Price \$150.11	<u>Taxed Ind</u> N
						_

/S670G1138959 Warranty

COMPLAINT:

04 LEAK ON POWER CAST TAIL BOARD CONTROL VALVE

oil leak on LH side of combine

CORRECTION:

removed power cast tail board control valve. replaced o ring on plug. reinstalled valve and tested operation.

d.

T77932 O-F	RING	3.00	1.62	1.62	\$4.86	Ν
T77857 O-F	RING	1.00	1.42	1.42	\$1.42	Ν
T77613 O-F	RING	3.00	1.38	1.38	\$4.14	Ν
51M7047 O-F	RING	2.00	3.04	3.04	\$6.08	Ν
	scription RING	Quantity 4.00	List Price 2.12	Net Price 2.12	Extended Price \$8.48	<u>Taxed Ind</u> N

/S670G1138884 Warranty

COMPLAINT:

05 REPAIR FOR OIL LEAK ON FEEDER HOUSE PUMP MOUNTING 0-RING



910 West Highway 36 Smith Center, KS 66967 Phone: 785-282-6601 Fax: 785-282-6958 www.landmarkimp.com Smithcenter@landmarkimp.com



Invoice To Account No:	Deliver To:		SE	RVICE INVOICE
WARRANTY			Invoice Number:	10471354
			Invoice Date:	5/11/2018
			Location:	03
			Work Order Number:	258350
			Payment Type:	Account
Bus Phone:				
Prv Phone:			Page:	3 of 6
Make/Model:	Mete	r: Serial Number:	Eq ID:	Fleet No:
JOHN DEERE S670		1H0S670STF0776360) PF776360	

/S670G1138884 Warranty

Removed pump stack and found no o ring on pump. installed new o ring and reinstalled pumps and tested operation.

<u>Part Number</u>	Description		<u>Quantity</u>	List Price	<u>Net Price</u>	Extended Price	<u>Taxed Ind</u>
E65288	O-RING		1.00	1.86	1.86	\$1.86	N
Labor: \$275.42	Parts: \$1.86	OL&M: \$0.00	Misc: \$0	0.00	Sub-To	otal: \$277.28	

/S670G1138964 Warranty

COMPLAINT:

06 GREASE LEAKING FROM CHOPPER TWO SPEED GEAR CASE

CORRECTION:

3-29

Removed lower chopper belts removed two speed chopper gear case

dissembled gear case and removed all bearing sand seals. Cleaned gear case.

3-30

Installed new bearings and o rings. filled with grease and installed on combine and tested operation

	121			12		
<u>Part Number</u> 40M7186	<u>Description</u> Snap Ring	Quantity 1.00		Net Price 6.71	Extended Price \$6.71	<u>Taxed Ind</u> N
51M7039	O-RING	TIMPLEMEI.00	1.13	1.13	\$1.13	Ν
AN102562	LUBRICANT	1.00	3.85	3.85	\$3.85	Ν
AXE11090	Ball Bearing	2.00	44.96	44.96	\$89.92	Ν
AXE11091	Ball Bearing	1.00	50.25	50.25	\$50.25	Ν
AXE11092	BALL BEARI	1.00	59.14	59.14	\$59.14	Ν
CE19970	O-Ring	1.00	2.80	2.80	\$2.80	Ν
CE32923	COMPRESSIO	1.00	3.03	3.03	\$3.03	Ν
E65288	O-RING	1.00	1.86	1.86	\$1.86	Ν
H64810	O-RING	1.00	3.82	3.82	\$3.82	Ν
R11120	O-RING	1.00	3.98	3.98	\$3.98	Ν
T74694	O-Ring	1.00	4.45	4.45	\$4.45	Ν
Labor: \$449.06	Parts: \$230.94	OL&M: \$0.00 Misc:	\$0.00	Sub-To	otal: \$680.00	



910 West Highway 36 Smith Center, KS 66967 Phone: 785-282-6601 Fax: 785-282-6958 www.landmarkimp.com Smithcenter@landmarkimp.com



SERVICE INVOICE

Invoice To Account No:	Deliver To:		SE	RVICE INVOICE
WARRANTY			Invoice Number:	10471354
			Invoice Date:	5/11/2018
			Location:	03
			Work Order Number:	258350
			Payment Type:	Account
Bus Phone:				
Prv Phone:			Page:	4 of 6
Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE S670		1H0S670STF0776360	PF776360	

/S670G1041323 Warranty

COMPLAINT: 07 REPLACE FRONT SHOE AUGER SHAFT

noise from front of combine

CORRECTION:

removed shoe auger cross shaft and installed new shaft with new bearings and hardware.

<u>Part Number</u> 14M7298	Description FLANGE NUT	<u>Quantity</u> 9.00	<u>List Price</u> 0.76	<u>Net Price</u> 0.76	Extended Price \$6.84	<u>Taxed Ind</u> N
19M7866	SCREW	9.00	0.87	0.87	\$7.83	Ν
26M4226	SHAFT KEY	1.00	2.27	2.27	\$2.27	Ν
AA5607R	SEAL	1.00	4.20	4.20	\$4.20	Ν
AH129451	BALL BEARI	1.00	38.11	38.11	\$38.11	Ν
AH129452	ECCENTRIC	1.00	9.43	9.43	\$9.43	Ν
AXE13435	LOCKING CO	1.00	22.55	22.55	\$22.55	Ν
E10018	PRESSED FL	2.00	4.40	4.40	\$8.80	Ν
H103264	PRESSED FLAN	5.00	2.11	2.11	\$10.55	Ν
H171186	SHAFT	1.00	272.93	272.93	\$272.93	Ν
HXE35167	Pressed Flanged Housing	1.00	7.81	7.81	\$7.81	Ν
JD8554	ECCENTRIC	2.00	6.77	6.77	\$13.54	Ν
JD8665	BALL BEARING	3.00	9.37	9.37	\$28.11	Ν
M48583	SHAFT KEY	4.00	6.35	6.35	\$25.40	Ν
Labor: \$592.76	Parts: \$458.37 OL&M: \$0.00	Misc:	\$0.00	Sub-To	otal: \$1,051.13	3

/S670G1138914 Warranty

COMPLAINT: 08 diagnose noise from LH final drive

CORRECTION: replaced Lh inner shaft and both couplers.



910 West Highway 36 Smith Center, KS 66967 Phone: 785-282-6601 Fax: 785-282-6958 www.landmarkimp.com Smithcenter@landmarkimp.com



SERVICE INVOICE Invoice To Account No: Deliver To: WARRANTY 10471354 Invoice Number: 5/11/2018 Invoice Date: Location: 03 Work Order Number: 258350 Account Payment Type: Bus Phone: 5 of 6 Prv Phone: Page: Make/Model: Meter: Serial Number: Eq ID: Fleet No: JOHN DEERE S670 1H0S670STF0776360 PF776360

/S670G1138914 Warranty

<u>Part Number</u> H218836	<u>Description</u> Shaft		<u>Quantity</u> 1.00	<u>List Price</u> 426.64	<u>Net Price</u> 426.64	Extended Price \$426.64	<u>Taxed Ind</u> N
HXE63494	Splined Coupling		2.00	76.60	76.60	\$153.20	Ν
Labor: \$167.65	Parts: \$579.84	OL&M: \$0.00	Misc: \$	0.00	Sub-Tot	al: \$747.49	

/S670G1138980 Warranty

COMPLAINT:

09 engine compartment hand rail is loose

CORRECTION: replaced handrail.

> Part Number AXE39776

Description






910 West Highway 36 Smith Center, KS 66967 Phone: 785-282-6601 Fax: 785-282-6958 www.landmarkimp.com Smithcenter@landmarkimp.com



Invoice To Account No:	Deliver	To:				SERVIC	E INVO	DICE
WARRANTY					Invoice Numbe	er:	104	71354
					Invoice Dat	te:	5/	11/2018
					Locatio	on:		03
				1	Nork Order Numbe	er:		258350
					Payment Typ	e:		Account
Bus Phone:								
Prv Phone:					Pag	e:		6 of 6
Make/Model:		Meter:	Serial Number:		Eq ID:	F	leet No:	
JOHN DEERE S670			1H0S670STF0776	6360	PF776360			
/S670G1138980 Warranty				6.00	0.00	0.00	¢0 54	N
R44302 TIE	BAND			6.00	0.09	0.09	\$0.54	N
Labor: \$95.80 Par	ts: \$268.48	OL&M:	\$0.00	Misc:	\$0.00	Sub-Total:	\$364.28	

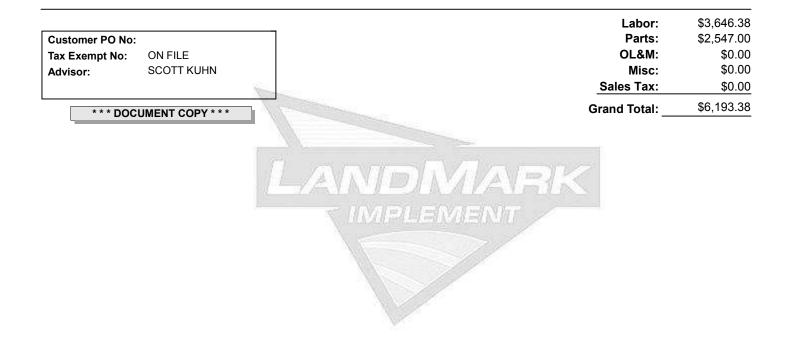

LANDMARK EXCLUSIVE WARRANTY OFFER! We're now offering a 1 year warranty on labor for all non-maintenance items only when work is completed by one of our factory trained John Deere technicians. For parts only purchase over the counter we have a 6 month warranty on John Deere parts.

TERMS AND CONDITIONS

Approved charges are due by the 10th of the month following purchase, I agree to pay a monthly periodic FINANCE CHARGE at the rate of 1.33% which is an ANNUAL PERCENTAGE CHARGE OF 16% on the unpaid balance. The purchaser agrees to pay reasonable attorney fees if collection efforts are required.



111 Chestnut Arapahoe, NE 68922 Phone: 308-962-7448 Fax: 308-962-5424 www.landmarkimp.com Arapahoe@landmarkimp.com



Invoice To Account No:	Deliver To:		SEF	RVICE INVOICE
Internal Used Stock No. 170094	Internal Used Stor	ck No. 170094	Invoice Number:	10566966
			Invoice Date:	10/12/2018
			Location:	07
			Work Order Number:	277598
			Payment Type:	Account
Bus Phone:	Bus Phone:			
Prv Phone:	Prv Phone:		Page:	1 of 4
Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE JD S670 COMBINE	1116	1H0S670STF0776360	PF776360	

/HCWASH2 Internal

COMPLAINT:

01 LEVEL 2 COMBINE WASH, WASH EXTERIOR AND UNDER SHIELDS

CORRECTION:

Labor: \$400.00	Parts: \$0.00	OL&M: \$0.00	Misc: \$0.00	Sub-Total:	\$400.00
/S670G1138826 Internal					
COMPLAINT: 02 CONCAVE, R&R - INCLU					
UZ CUNCAVE, RAR - INCLU	JDES LEVELING				
CORRECTION:	15				
- ,		/IRE CONCAVES FROM COM			
		ERVICEABLE. SET COMBINE COMBINE OPERATION, GOOD		UTSIDE	
SETTINGS AND THROUGH	DISPLAT. CHECKED C	COMBINE OFERATION, GOOL			
		SE CONVEYOR CHAIN AND D	a the second of the second of the second sec		
	- ,	GE BEATER, AND ROTARY JA	CKSHAFT BELTS.		
ADJUSTED TENSION ON (CHECKED OPERATION AC		LINGS ELEVATORS.			

Labor: \$598.75	Parts: \$0.00	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$598.75

/S670G000012 Internal

COMPLAINT: 03 LANDMARK COURTESY PRE-WORK CHECKLIST MAKE SURE WE FILL OUT CHECK LIST. CHECK CHAFFER FRAME



111 Chestnut Arapahoe, NE 68922 Phone: 308-962-7448 Fax: 308-962-5424 www.landmarkimp.com Arapahoe@landmarkimp.com



SERVICE INVOICE

Invoice To Account No:	Deliver To:		SE	ERVICE INVOICE
Internal Used Stock No. 170094	Internal Used	Stock No. 170094	Invoice Number:	10566966
			Invoice Date:	10/12/2018
			Location:	07
			Work Order Number:	277598
			Payment Type:	Account
Bus Phone:	Bus Phone:			
Prv Phone:	Prv Phone:		Page:	2 of 4
Make/Model:	Mete	r: Serial Number:	Eq ID:	Fleet No:
JOHN DEERE JD S670 COMBINE	1116	1H0S670STF0776360	PF776360	

/S670G000012 Internal

abor: \$20.36 Parts: \$0.00	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$20	.36
Cab Interior Damage				
Cracks in Plastic/Fiberglass Parts. Paint/Finish Damage	1.1	27/		
Damaged Glass/Mirrors	Victoria and a second			
PHYSICAL DAMAGE	< INABLE			
Check Service Intervals				
DTC's, SERVICE INTERVALS (CODES) Recall & Record DTC's		VIAVE		
		VITANDY	17	
Engine Coolant				
Engine Oil		Contract of Contract		
FLUID LEVELS				
Operation of All Controls in the Cab Seat Operation and Adjustments	and the second se			
Radio Operation				
Light system, Field and Road				
A/C & Heater Operation				
OPERATOR STATION				
Hydraulic oil				
Coolant Fuel				
Engine oil				
LEAKS				
SMV Emblem				
Warning Lights				
Steps and Handrails				
PTO Shields				

/S670SERVICE Internal

COMPLAINT:

04 SERVICE COMBINE FILTERS AND FLUIDS



111 Chestnut Arapahoe, NE 68922 Phone: 308-962-7448 Fax: 308-962-5424 www.landmarkimp.com Arapahoe@landmarkimp.com



SERVICE INVOICE Invoice To Account No: Deliver To: Internal Used Stock No. 170094 Internal Used Stock No. 170094 Invoice Number: 10566966 Invoice Date: 10/12/2018 Location: 07 Work Order Number: 277598 Account Payment Type: Bus Phone: Bus Phone: 3 of 4 Prv Phone: Prv Phone: Page: Make/Model: Meter: Serial Number: Eq ID: Fleet No: 1H0S670STF0776360 JOHN DEERE JD S670 COMBINE 1116 PF776360

/S670SERVICE Internal

REPLACED ALL FILTERS. DRAINED; ENGINE OIL. REVERSER GEARCASE. PRIMARY COUNTERSHAFT GEARCASE. REFILLED TO SPECIFICATIONS. CHECKED THE COMBINE FOR; JOHN DEERE RECOMMENDED TIRE PRESSURES. ALL FLUID LEVELS ARE AT SPECIFIED LEVELS. REMOVED AND CLEANED CAB AIR PRE-CLEANER. GREASED ALL LUBE POINTS ON THE COMBINE. REPAIRS/ADJUSTMENTS NOT COVERED ON THIS SEGMENT.

T734 T750

<u>Part Number</u> AXE42066	Description Filter Element	<u>Quantity</u> 1.00	List Price 89.85	Net Price 89.85	Extended Price \$89.85	<u>Taxed Ind</u> N
HXE11090	Filter Element	1.00	165.93	165.93	\$165.93	Ν
L214634	Recirculating Filter	1.00	18.58	18.58	\$18.58	Ν
RE284091	Cab Air Filter	1.00	59.18	59.18	\$59.18	Ν
RE509672	Oil Filter Element	1.00	19.24	19.24	\$19.24	Ν
RE533910	Fuel Filter	1.00	117.17	117.17	\$117.17	Ν
RE539465	Filter Element	1.00	95.41	95.41	\$95.41	Ν



111 Chestnut Arapahoe, NE 68922 Phone: 308-962-7448 Fax: 308-962-5424 www.landmarkimp.com Arapahoe@landmarkimp.com



Invoice To Account No:	Deliver To:			SERV	ICE INVO	DICE
Internal Used Stock No. 17	0094 Internal Used Sto	ck No. 170094	Invoice Numbe	r:	105	66966
			Invoice Dat	e:	10/	12/2018
			Locatio	n:		07
			Work Order Numbe	er:		277598
			Payment Typ	e:		Account
Bus Phone:	Bus Phone:					
Prv Phone:	Prv Phone:		Page	e:		4 of 4
Make/Model:	Meter:	Serial Number:	Eq ID:		Fleet No:	
JOHN DEERE JD S670 COM	IBINE 1116	1H0S670STF0776360	PF776360			
/S670SERVICE Internal	Plus-50 II Oil 15W40 CJ4/SN	20.0	00 15.00	15.00	\$300.00	N

_	Labor: \$598.75	Parts: \$865.36	OL&M:	\$0.00	Misc: \$	\$0.00	Sub-Total:	\$1,464.11	
	TY26682	Plus-50 II Oil 15W40 CJ4/S	N		20.00	15.00	15.00	\$300.00	Ν

		Labor: Parts:	\$1,617.86
Customer PO N	NO:	Parts:	\$865.36
Tax Exempt No	x.	OL&M:	\$0.00
Advisor:	SCOTT HAMILTON	Misc:	\$0.00
		Sales Tax:	\$0.00
* * * D	OCUMENT COPY * * *	Grand Total:	\$2,483.22



LANDMARK EXCLUSIVE WARRANTY OFFER! We're now offering a 1 year warranty on labor for all non-maintenance items only when work is completed by one of our factory trained John Deere technicians. For parts only purchase over the counter we have a 6 month warranty on John Deere parts.

TERMS AND CONDITIONS

Approved charges are due by the 10th of the month following purchase, I agree to pay a monthly periodic FINANCE CHARGE at the rate of 1.33% which is an ANNUAL PERCENTAGE CHARGE OF 16% on the unpaid balance. The purchaser agrees to pay reasonable attorney fees if collection efforts are required.